



5909 6<sup>™</sup> STREET S.E. CALGARY, AB T2H 1L8 (403) 253-7555

Sold To: TRIVEE TRANSPORT LTD 4993 234175 WRANGLER RD ROCKYVIEW, AB T1X 0K2 Ship To: TRIVEE TRANSPORT LTD 234175 WRANGLER RD ROCKYVIEW, AB T1X 0K2

CUSTOMER INVOICE Work Order

SC1026254

Date: 02-08-23 403 279-1748 Page 1 of 2 Year Make / Model Serial Number License Mileage Unit/Stock 2021 Kenworth / T680 1XKYD49X3MJ973974 COMPLETEDX 724248 973974 Delivery Date Transmission Model/Serial # **Delivery Mileage** Engine Model / Serial # 04-14-20 X15 / 80248683 FULLER RTLO18918B 18-SPEED SUPE / K1367161 CPL/ARRG **Rear Ratio** Rear Axle Model / Serial # Rear Axle Model / Serial # 2 MT40-14X3 FOR04076092 FOR06392671 3.42 **Engine Hours Reefer Hours** Standby Hours P.O. Number **Open Date / Time** Complete Service Writer 12134.0 02-07-23 / 03:34PM 81 02-08-23 JWL\*JWL LINDSEY . 403-279-1748 Memo Tax ID Date: 03-15-99 Tax ID: 1 CHECK/REPLACE FAN HUB IS LEAKING CAUSE: FAN HUB LEAKING INTERNALY CORRECTION: 730 - VRIFIED THE FAN HUB IS LEAKING FROM THE REAR PORT.REMOVED FAN BLADE, FAND BELT AND TENSIONER.REMOVED CRANK CASE RESINATOR AND DAMPNER.REMOVED ENGINE AIR COMPRESSOR FEED TUBES.REMOVED FAN FROM ENGINE.STRIPPED DOWN FAN HUB AND REPLACED INTERNAL SEALS AND PISTON.RE-BUILD AND INSTALLED ALL COMPONENTS.TESTED OPERATION. TOTAL LABOR 1,134.00 TOTAL PARTS 180.34 Qty Part Number Description Unit Extended 4.62 9.24 2 5658098CUM SEAL,O RING 1 994346H0R SEAL-KIT 171.10 171.10 2 CHECK OVERINFLATION VALVE - WONT DUMP IF OVERINFLATED CAUSE: ELECTRIC OVER AIR SOLENOID EXHAUST PORT CORRODED. CORRECTION: 730 - VERIFIED COMPLAINT, REMOVED OVER INFLATION VALVE ARM AND VERIFIED THE VALVE WORKS.REMOVED THE AIR LINE TO THE ELEC/AIR SOLENIOD AND THE SUSPENSION STARTED TO DROP. THE EXHAUST PORT IS CORRODED AND PREVENTING THE AIR TO RELEASE.NOTICED THE REMAINING 4 SOLENOID EXHAUST PORTS ARE ALSO CORRODED.REPLACED ALL SOLENOIDS (5 IN TOTAL) TO PREVENT FUTURE ISSUES.VERIFIED REPAIRS, ALL NOW WORKS AS SHOULD. TOTAL LABOR 529.20 TOTAL PARTS 437.35 Qty Part Number Description Unit Extended \_\_\_\_\_ 5 5602-01-020 KIT-SOLENOID SERVICE, PUS 87.47 437.35 SHOP SUPPLIES 166.32 G.S.T. - REG. NO. R139766661 5 % OF 2,447.21 = 122.36

Date: 02-08-23

Work Order

### SC1026254

Page 2 of 2

CUST MECH LAB-CAL	1,663.20
PARTS CUSTOMER R/O-CAL	617.69
SHOP SUPPLIES-SHOP A	166.32
G.S.T. R139766661	122.36
PLEASE PAY THIS TOTAL	2,569.57

I ACKNOWLEDGE THAT I WILL BE RESPONSIBLE FOR ALL COST INCURRED TO DIAGNOSE, ROAD TEST, DISMANTLE AND REASSEMBLE MY UNIT IF NO FAULT CAN BE FOUND.

THE MANUFACTURER WARRANTY CONSTITUTES ALL OF THE WARRANTIES WITH RESPECT TO THE SALE OF THIS ITEM/ITEMS. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESSED OR IMPLIED, INCLUDING AND IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. SELLER NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF THIS ITEM/ITEMS.

GREATWEST KENWORTH LTD. MAKES THE LIMITED WARRANTY COVERING ANY DEFECT IN WORKMANSHIP OR MATERIAL FURNISHED IN CONNECTION WITH THIS REPAIR ORDER FOR A PERIOD OF THIRTY (30) DAYS FROM THE DATE OF DELIVERY OF SAID MOTOR VEHICLE TO THE CUSTOMER/OWNER, OR 16,000 KILOMETERS WHICHEVER OCCURS FIRST.

IT IS UNDERSTOOD THAT A LIEN MAY BE PLACED THEREON FOR THE AMOUNT DUE IN CASE THE VEHICLE REPAIRS ARE NOT PAID IN FULL.

Customer: X\_\_\_\_\_

\_\_\_\_\_ Date: \_\_\_\_\_

CALGARY -- CLAIRMONT -- LETHBRIDGE -- MEDICINE HAT -- RED DEER



### Invoice

SOLD BY

Inland Kenworth (Los Angeles) Inc. 1600 Washington Blvd Montebello, CA 90640 United States Dealer ID: 2414 PACCAR Dealer Code: I136



SOLD TO Trivee Transport Ltd - US 234175A Wrangler Rd Rocky View, AB T1X 0K2 Canada PACCAR Fleet Code: 4F72

emittance advice can be included with a check payment or emailed to		Invoice/RO Number	19143MNS
remittance@paccarpartsfleetservic	nittance@paccarpartsfleetservices.com.		04/15/2023
Check PACCAR Parts Fleet Services	EFT	Approval Code	
P.O. Box 731165	ABA Routing Number: 103000648	Site ID	Trivee Transport - US
Dallas, TX 75373-1165	ACH Account Number: 837393818	P.O. Number	MJ973974
USA	Account Number: 007000010	SR Number	
Wire			BURGANDY
Chase ABA Routing Number: 021000021		Unit Number VIN	1XKYD49X3MJ973974
Account Number: 837393818		Odometer	754785

Quantity	Item SKU	Description	Item Type	Fleet Price	Dealer Price	Total Adjustment	Final Amount
Quantity	309701-35	CLUT SELFADJ 15.5,2050TRQ,	PACCAR Part	\$1,456.02	\$1,456.02	\$0.00	\$1,456.02
A STATE OF	FREIGHT	FREIGHT OUT	Other Part	\$150.00	\$150.00	\$0.00	\$150.00
THE REAL	6306LLUA1C3/2E	BEARING	PACCAR Part	\$14.90	\$14.90	\$0.00	\$14.90
Constant and the	127760DAN	BRAKE-CLUTCH 2.000-10 SPLI	The second s	\$32.39	\$32.39	\$0.00	\$32.39
1	5315PEN	FLUID-HEAVY-DUTY STARTIN	PACCAR Part	\$3.46	\$3.46	\$0.00	\$10.38
20	CT05317	TIE-CABLE 50LB 15.5" BLK	PACCAR Part	\$0.17	\$0.17	\$0.00	\$3.40
20	4305294	GASKET-SHIFT LEVER HOUSI	PACCAR Part	\$10.96	\$10.96	\$0.00	\$10.96
1	84103FUL	CONNECTOR ASSY	PACCAR Part	\$11.57	\$11.57	\$0.00	\$46.28
4	G38-1044-060404	FITTING-BRANCH Y NPT TO J	PACCAR Part	\$23.94	\$23.94	\$0.00	\$23.94
2	FG9109	FITTING-PM BULKHEAD UNIO	PACCAR Part	\$10.62	\$10.62	\$0.00	\$21.24
<ul> <li>C</li> <li>C</li></ul>	A7786	CLUTCH FORK	PACCAR Part	\$317.57	\$317.57	\$0.00	\$317.57
1110年1月1日1月1日	K2468	KIT-CLUTCH INSTALL	PACCAR Part	\$225.08	\$225.08	\$0.00	\$225.08
0	X7C1202M	SCREW-HEAX HD/WASHER A	PACCAR Part	\$4.64	\$4.64	\$0.00	\$9.28
4	E17-6012	CLUTCH SERVO	PACCAR Part	\$630.60	\$630.60	\$0.00	\$630.60
100000000000000000000000000000000000000	35101	PULL DOWEL PIN 1/4X1 FULL	PACCAR Part	\$44.99	\$44.99	\$0.00	\$44.99
AND DESCRIPTION OF	E17-6011	CYLINDER-MASTER CLUTCH	PACCAR Part	\$403.59	\$403.59	\$0.00	\$403.59
	3687930RXCUM	SENSOR,NITROGEN OXIDE	PACCAR Part	\$595.22	\$595.22	\$0.00	\$595.22
ALC: NOT A	3687930RXCUM	CORE CHARGE	Core	\$212.50	\$212.50	\$0.00	\$212.50
S. C. Standard	3687930RXCUM	CORE RETURN	Core	\$212.50	\$212.50	\$0.00	-\$212.50
-1	NAME AND ADDRESS OF A DREAM AND ADDRESS OF ADDRESS OF A DREAM AND ADDRESS OF ADDRESS OF A DREAM AND ADDREAM AND AD	023 C/A CLUTCH INOPERATIV	State of a second of the second of the second s	\$215.65	\$215.65	\$0.00	\$1,735.98
8.05	023-GEN	CLUTCH PEDAL OP AND FOUND	CLUTCH PEDAL				TCH CYL AND

754785 CHECKED TRANS AND CLUTCH PEDAL OP AND FOUND CLUTCH PEDAL DOESNT HAVE ANY PRESSURE. INSPECTED CLUTCH CYL AND LINES AND CLUTCH RODS AND FOUND ALL OK. REMOVED CLUTCH INSPECTION COVER TO INSPECT CLUTCH CONDITION AND FOUND CLUTCH BRO

2	010-TAL	010 C/A AIR SYSTEM LEAKAG	Labor	\$217.00	\$217.00	\$0.00	\$434.00
754785	State of the state of the state						40 170 00
10	023-001-022	023 CLUTCH ASSEMBLY REP		\$217.00	\$217.00	\$0.00	\$2,170.00
754785	Inspected all trans ar	nd clutch components and found broken of	clutch assembly. A	lso flywheel will nee	ed to be re-surface	d. We also found t	rans input
shaft dar	maged along with clu	tch fork which needs replacement. Clutch	h master cylinder i	s leaking fluid.		A CONTRACTOR OF	
2	026-001-039	026 TRANSMISSION INPUT SH		\$217.00	\$217.00	\$0.00	\$434.00
754785	inspected all trans ar	nd clutch components and found broken of	clutch assembly. A	lso flywheel will nee	ed to be re-surfaced	d. We also found t	rans input
shaft dar	maged along with clu	tch fork which needs replacement. Clutch	h master cylinder i	s leaking fluid.			The second second
3	023-001-022	023 R&R BOTTOM CLUTCH C		\$217.00	\$217.00	\$0.00	\$651.00
754785	inspected all trans ar	nd clutch components and found broken of	clutch assembly. A	lso flywheel will nee	ed to be re-surface	d. We also found t	rans input
		tch fork which needs replacement. Clutch					•
2.06	045-004-001	045 RESURFACE FLYWHEEL		\$210.68	\$210.68	\$0.00	\$434.00
754785				的 語言 医 语言			and a start
2.1	043-007-071	043 NOX SENSOR - UPSTREA	Labor	\$206.67	\$206.67	\$0.00	\$434.01
754785							
1	023-GEN	023 C/A CLUTCH INOPERATIV	Labor	\$0.02	\$0.02	\$0.00	\$0.02
-1	043-007-071	043 NOX SENSOR - UPSTREA	Labor	\$0.01	\$0.01	\$0.00	-\$0.01
-	SUBLET	RESURFACE FLYWHEEL	Miscellaneous	\$130.00	\$130.00	\$0.00	\$130.00

Remit Payment to PACCAR Parts Fleet Services, P.O. Box 731165, Dallas, TX 75373-1165023

For PACCAR Customer Support call 1-888-977-2787

Send inquiries to PO Box 10922, Shawnee Mission, KS 66225-9022 or support@paccarpartsfleetservices.com



### Invoice

	Description	Item Type	Fleet Price	Dealer Price	Total Adjustment	Final Amount
Quantity Item SKU	Description	and the second se	\$499.00	\$499.00	\$0.00	\$499.00
1 SHOP	SHOP CHARGE	Miscellaneous	Contraction of the second s	and the second se	\$0.00	\$460.72
1	Sales Tax	Sales Tax	\$460.72	\$460.72	φ0.00	φτ00.72

Summary of	f Charges	
Parts	\$3,845.84	
Other Parts	\$150.00	
Labor/Other	\$6,922.00	
Freight	\$0.00	
Tax	\$460.72	
Total Adjustment	\$0.00	
Final Amount	\$11,378.56	

#### Service Notes

Remit Payment to PACCAR Parts Fleet Services, P.O. Box 731165, Dallas, TX 75373-1165

For PACCAR Customer Support call 1-888-977-2787 Send inquiries to PO Box 10922, Shawnee Mission, KS 66225-9022 or support@paccarpartsfleetservices.com

Copyright 2023. TreviPay is a trademark and copyright owned and operated

QTY	Parts/Materials	PRICE	-	TRIVEE			
42	Oil in Litres			TRANSPORT			
	OIL FILTERS			234175A Wrangler Road		RECEIVED SEP / 4 2024	
	1948921PE (LF16233FLG)			Rocky View, Ab T1X 0K2			
	2234788PE (LF16368FLG)			P) 403-279-1748			
1	LF14001NNFLG			C×1			21
	1922496PE (CS41044FLG)		NAME:	81	DATE:	<u>08/30/24</u> 1,000, 332	2>1
			-				
	FUEL FILTERS		CHARGE TO:		Miles:	1.000.332	1
	2277129PE		-				
1	FF5825NNFLG		DESCRIPTION	OF WORK PERFORMED			
	FF5971NNFLG						
	FS19764FLG		Chango	oil oil filters	F. Fu	ol filters	
	K37-1012 (FS20173FLG)						
1	K37-1021 (FS20207FLG)		Grense	Frontend and Clu	teh		
	K37-1029 (FS20172FLG)						
			Check	tile OS: Steer	s Que la	U KUS'	
	LIGHTS			tire BS: Steer			
				drive	es all	OPS.	
1.1					$\smile$	Ŷ	
	SHOCKS				•		
din 1	SEALS				14.5 14.5		
					•		
	BRAKES				5.	· · · · · · · · · · · · · · · · · · ·	
<u> </u>							
-			S				
TOTAL	ADTS AAATEDIALS						
TOTAL	PARTS/MATERIALS			ORIZE THE ABOVE WORK TO BE DO			
			WITH NECESSA	RY MATERIAL, AND TO BE PAID IN I	FULL.	TOTAL PARTS/MATERIALS	
			SIGNATURE:	~ / //			
			SIGNATORE.	$\sim$ - $\theta$		SUB TOTAL GST	
						TOTAL	
						IUIAL	

QTY	Parts/Materials	PRICE	י ר	TRIVEE			
	Oil in Litres			TIANSPORT			
	OIL FILTERS			234175A Wrangler Road			
	1948921PE (LF16233FLG)			Rocky View, Ab T1X 0K2			
1	2234788PE (LF16368FLG)			P) 403-279-1748			
	LF14001NNFLG			- -			
	1922496PE (CS41044FLG)		NAME:	81	DATE:	Dec. + 3 13/23 870, 881	
			_	·			
	FUEL FILTERS		CHARGE TO:		Miles:	870,88	
	2277129PE				_		
	FF5825NNFLG		DESCRIPTION	N OF WORK PERFORMED			
	FF5971NNFLG						
	FS19764FLG		Fix DUN	wer Steeling hose.	ORing	, Put new	
	K37-1012 (FS20173FLG)			ver Steering huse, teering filter a of ATF.	J	· · · · · · · · · · · · · · · · · · ·	
	K37-1021 (FS20207FLG)		Quince S	teering filter a	nd gas	ket in 2	
	K37-1029 (FS20172FLG)		] [	1	0		
			Jug5 0	F ATF.			
	LIGHTS			• • •			
				1			
	SHOCKS		Fix a	ir leak	<u>-</u>		
	SEALS						
	L						
	BRAKES						
TOTAL	PARTS/MATERIALS		I HEREBY AUT	HORIZE THE ABOVE WORK TO BE	DONE TOGET	HER TOTAL SHOP LABOUR	
			WITH NECESS	ARY MATERIAL, AND TO BE PAID I	N FULL.	TOTAL PARTS/MATERIALS	
				0 /1/			
			SIGNATURE: _	6/2/		SUB TOTAL	
				-		GST	
						TOTAL	

## DWT Truck & Trailer Repair Inc.

TRUCK & TRAILER REPAIR

10768 74 Street SE Calgary, AB T2C-5N6 403-279-6299

#### Mailing Address:

60 Cranberry Ave SE Calgary, AB T3M0L6 INVOICE

Invoice no:

6926

Date:

2024-02-26

#### Customer: Trivee Transport Ltd.

Lindsay/Henry/Sandy 234175 Wrangler Road Rockyview County, AB T1X 0K2

Quantity Unit	Description	Unit Price	Amount
Quantity Unit 7 Hour 1 Each 1 Each 1 Each 1 Each 1 Each 1 Each	Feb 21/2024 Unit# 81 VIN: 1XKYP49X3MJ973974 Km: 905985 Truck Labour Check unit for derate. Found several codes related to VGT actuator. Drained coolant and removed VGT. Found turbo oil seal had blown. The VGT had been filled with oil. Requires a new VGT and turbo. Removed turbo. Found #2 exhaust manifold gasket leaking. Removed turbo. Found #2 exhaust manifold gasket leaking. Removed manifold and found #2 lower bolts broken. Cleaned necessary components and reassembled with new gaskets. Installed new turbo and VGT. Calibrated. Topped up coolant and ran unit. All codes inactive. Ran unit. While running noticed A/C belt tensioner defective. Removed and replaced tensioner. Tested, operational. Turbo Turbo Core Actuator Belt Tensioner	Unit Price	840.00 8,260.43 977.50 2,117.79
1 Each 1 Each	Installed new turbo and VGT. Calibrated. Topped up coolant and ran unit. All codes inactive. Ran unit. While running noticed A/C belt tensioner defective. Removed and replaced tensioner. Tested, operational. Turbo Turbo Turbo Core Actuator	977.50 2,117.79	977.50 2,117.79 288.36 164.64 65.52 74.40 63.06
	Subtotal: G - GST 5% GST/HST		13,075.94 653.80
DWT Truck and Trailer Rep	air Inc. GST/HST: # 717021885RT0001		40 700 74
All wheels nuts must be reto	rqued after 150 kms	Total Amount	13,729.74
Wheel alignment recommen	ded after all suspension work	Amount Paid	0.00
Thank you for doing busir	ness with us !	Amount Owing	13,729.74

T	RR		M		E
TR	AF	NS		DOG	27

234175 Wrangler Road Rocky View, AB T1X 0K2

### **Tire Report**

Date: Jan 10/24

Unit #:

Tires Installed by:

Tires

# of Tires

Type & Placement

Notes

4

.

81

8	118 22.5 Michelia X line energy D	
	IlR 22.5 Michelin X line energy D inside and outside both near arles	
	@ 884,712 Km	

Signature:

## DWT Truck & Trailer Repair Inc.

TRUCK & TRAILER REPAIR

10768 74 Street SE Calgary, AB T2C-5N6 403-279-6299

#### Mailing Address:

60 Cranberry Ave SE Calgary, AB T3M0L6 INVOICE

Invoice no:

7497

Date:

2024-07-03

#### Customer: Trivee Transport Ltd.

Lindsay/Henry/Sandy 234175 Wrangler Road Rockyview County, AB T1X 0K2

Quantity	Unit	Description	Unit Price	Amount
		June 27/2024 Unit# 81 Plate# U58370 VIN: 1XKYD49X3MJ973974 Km: 969839		
3.00 Axle	le	Commercial Vehicle Inspection	120.00	360.00
1.50 Hou	ur	Truck Labour	120.00	180.00
		Replaced left #2 drive brake pot. Replaced missing brake pot plug on right #1 drive. Replaced #1 drive torque rod using new bolts. Removed broken license plate light. Greased unit and torque all wheels.		
1.00 Eac 1.00 Eac 0.25 Tub 1.00 Eac 2.00 Eac 2.00 Eac 1.00 Eac 1.00 Eac	ch be ch ch ch ch ch	Torque Rod Air Disc Chamber Grease Brake Pot Plug 5/8" x 4" Bolt Kit 5/8" x 6" Bolt Kit Zip Tie Shop Supplies Subtotal: G - GST 5% GST/HST	222.89 168.75 8.80 4.05 4.57 7.95 0.60 9.00	2.20 4.05 9.14 15.90 1.20
DWT Truck and Tra	railer Repa	ir Inc. GST/HST: # 717021885RT0001	Total Amount	1,021.79
All wheels nuts mus	ust be retor	qued after 150 kms	Amount Paid	0.00
Wheel alignment re Thank you for doi		ded after all suspension work	Amount Owing	1,021.79

				TOTAL F					2						_									_			-	4/2	QTY
				TOTAL PARTS/MATERIALS		BRAKES		SFALS	SHOCKS drive			LIGHTS	100 M	K37-1029 (FS20172FLG)	K37-1021 (FS20207FLG)	K37-1012 (FS20173FLG)	FS19764FLG	FF5971NNFLG	FF5825NNFLG	2277129PE	FUEL FILTERS		1922496PE (CS41044FLG)	LF14001NNFLG	2234788PE (LF16368FLG)	1948921PE (LF16233FLG)	OIL FILTERS	Oil in Litres	Parts/Materials
																													PRICE
	(	SIGNATURE:	WITH NECESSARY MATERIAL, AND TO BE PAID IN FULL.	I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE TOGETHER			vere lasting		Keplaced all 4 drive Shacks due	) - (	disres a 20 psi		Shock tire PSI Stears Inder	0000	Grease Flast and alus cluter		Change dil ailfiller final fillars		DESCRIPTION OF WORK PERFORMED		CHARGE TO: Miles: 962 174	0	NAME: SI DATE: T		P) 403-279-1748	Rocky View, Ab T1X 0K2	234175A Wrangler Road		
TOTAL	GST	SUB TOTAL	TOTAL PARTS/MATERIALS	TOTAL SHOP LABOUR					te call												774	171 151	11/16						
-	·																			I		1							

Y	Parts/Materials	PRICE	TRIVEE	
** *	Oil in Litres		TRANSPORT	
	OIL FILTERS		234175A Wrangler Road	
	1948921PE (LF16233FLG)		Rocky View, Ab T1X 0K2	
19.19	2234788PE (LF16368FLG)		P) 403-279-1748	
	LF14001NNFLG		구경 영상 문화에서 집중 방법을 받았는 것 것은 것을 가지 않는 것 같아. 이렇는 것 같아. 가지 않는 것 같아.	
	1922496PE (CS41044FLG)		NAME: 81 DATE: Nov. 18123	
	FUEL FILTERS		NAME:         81         DATE:         Nov. 18123           CHARGE TO:         Miles:         857, 720	
	2277129PE			
	FF5825NNFLG		DESCRIPTION OF WORK PERFORMED	
	FF5971NNFLG			
-	FS19764FLG		Replace Hanger Bearing and Front UJoint off of transmission	
	K37-1012 (FS20173FLG)		applied nonger rearing one rout a being	
	K37-1021 (FS20207FLG)		off of transmission	
	K37-1029 (FS20172FLG)			
	LIGHTS			
	SHOCKS			
	SEALS			
1999-1499 	BRAKES			
TAL	PARTS/MATERIALS		I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE TOGETHER TOTAL SHOP I	
			WITH NECESSARY MATERIAL, AND TO BE PAID IN FULL. TOTAL PARTS/MA	
				TERIALS
			SIGNATURE: SU	B TOTAL
				GST
				TOTAL

Y	Parts/Materials	PRICE	TRIVEE	
** *	Oil in Litres		TRANSPORT	
	OIL FILTERS		234175A Wrangler Road	
	1948921PE (LF16233FLG)		Rocky View, Ab T1X 0K2	
19.19	2234788PE (LF16368FLG)		P) 403-279-1748	
	LF14001NNFLG		구경 영상 문화에서 집중 방법을 받았는 것 것은 것 같은 것 같은 것 같이 다. 나는 것 같은 것 같	
	1922496PE (CS41044FLG)		NAME: 81 DATE: Nov. 18123	
	FUEL FILTERS		NAME:         81         DATE:         Nov. 18123           CHARGE TO:         Miles:         857, 720	
	2277129PE			
	FF5825NNFLG		DESCRIPTION OF WORK PERFORMED	
	FF5971NNFLG			
-	FS19764FLG		Replace Hanger Bearing and Front UJoint off of transmission	
	K37-1012 (FS20173FLG)		applied nonger rearing one rout a being	
	K37-1021 (FS20207FLG)		off of transmission	
	K37-1029 (FS20172FLG)			
	LIGHTS			
	SHOCKS			
	SEALS			
1999-1499 	BRAKES			
TAL	PARTS/MATERIALS		I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE TOGETHER TOTAL SHOP I	
			WITH NECESSARY MATERIAL, AND TO BE PAID IN FULL. TOTAL PARTS/MA	
				TERIALS
			SIGNATURE: SU	B TOTAL
				GST
				TOTAL

QTY Parts/Materia	Is PRICE		TRIVER			
Oil in Litres			TRANSPORT	r		
OIL FILTERS			234175A Wrangler Road			
1948921PE (LF	F16233FLG)		Rocky View, Ab T1X 0K2			
2234788PE (LF	F16368FLG)		P) 403-279-1748			
LF14001NNFL	G					
1922496PE (C	S41044FLG)	NAME:	81	DATE:	Oct. 28/23	
FUEL FILTERS		CHARGE TO:	:	Miles:		
2277129PE						
FF5825NNFLG		DESCRIPTIC	ON OF WORK PERFORMED			
FF5971NNFLG						
FS19764FLG		install	led her heater	Core		
K37-1012 (FS2	20173FLG)		¥ )			s her b
K37-1021 (FS2	20207FLG)	Part	#(P) W2046ca			
K37-1029 (FS2	20172FLG)			di -		
		Put	new filter in	Part SU	200092	
LIGHTS			new filter in into highbeams			
		looked	into highbeams	Lefth	and blowen fuse	
SHOCKS		replace	d with anew	20 amp		
				Production of the second se		
SEALS						
BRAKES		Hojust	ed low begins	is per	requested by	
		- diin		× i		
		Criv	с <i>V</i>			
						Contraction and contract
TOTAL PARTS/MATERIA	LS		JTHORIZE THE ABOVE WORK TO			
		WITH NECES	SSARY MATERIAL, AND TO BE PAI	d in full.	TOTAL PARTS/MATERIALS	
		SIGNATURE			SUB TOTAL	
					GST	o skoutene
					TOTAL	

# TRIVEE TRANSPORT LTD.

**REPAIR REQUEST** (tires, lights, reefer problems) Date: 22-10-2023 Reported by: Claude Lebanc (driver name & number)

If lights are out on trailer count from the back red one (that being #1)

Service Work Required:

81

Unit#

Smell of Anti-FREEZE when heater or A/C. ON

DROP OFF REPAIR REQUEST FORMS IN WALL FILE IN LUNCHROOM

Odometer:		Date:	1. 28/23
Cemplete			
v			
	ч.,		

Service Work Performed by: \_\_\_\_\_

QTY	Parts/Materials	PRICE	TRIVEE	
42	Oil in Litres		transfort	
	OIL FILTERS		234175A Wrangler Road	
	1948921PE (LF16233FLG)		Rocky View, Ab T1X 0K2	
	2234788PE (LF16368FLG)		Р) 403-279-1748	
. ]	LF14001NNFLG			
	1922496PE (CS41044FLG)		NAME:     8/     DATE:     April 3/24       CHARGE TO:     Miles:     927,160	
			Q17 V	
	FUEL FILTERS		CHARGE TO: Miles:27, 160	
	2277129PE			
1	FF5825NNFLG		DESCRIPTION OF WORK PERFORMED	
	FF5971NNFLG			
	FS19764FLG	1	Change dil, dil filter, and fuel filters	
	K37-1012 (FS20173FLG)			
1	K37-1021 (FS20207FLG)		Corease Front	
	K37-1029 (FS20172FLG)			
			Check brake puts	
	LIGHTS			
			Crease Front Check brake puts Check tire psi steers@lupsi dives@ 20 psi	
	SHOCKS		dives a zupsi	
	SEALS			
	DD AKEC			
	BRAKES			
τοτλι	PARTS/MATERIALS		I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE TOGETHER TOTAL SHOP LABOU	R
TOTAL			WITH NECESSARY MATERIAL, AND TO BE PAID IN FULL.	
			SIGNATURE: SUB TOTA	L
			GS	т
			ΤΟΤΑ	L