



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-01250WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit:	1515	Serial Number:	1XKDP4TX8ER969355
Manufacturer:	Kenworth	Model:	T800
Year:	2014		
Hours:	25,120	KM's:	1,115,928

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Replace both steer tires	2		CA\$ 0.00

Repair Story: Punch #2 (Line 1) - 07/08/2026: Removed both steer wheels off truck. Removed old rubber and mounted new. Pumped both tires to 120 PSI. Installed both wheels on truck to a torque of 500 FT LBS. Wrote tourque tag. Did not mark lugs as was told its getting shown to a customer and to just install chrome caps after wheel tourqe.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: Replace mud flaps	1.5		CA\$ 0.00

Repair Story: Punch #3 (Line 2) - 07/08/2026: Went and got new RTRC mud flaps out of storage. Cut to size and drilled holes. Had to steal other hangers off other truck as this was a rush. Swapped over flaps and installed new flaps on hangers on truck.

Punch #4 (Line 2) - 07/08/2026: Got 2 new black mud flaps. Cut to size. Drilled holes. Installed flaps on new hangers. Installed mud flaps on truck we stole them off of.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	: Oil drain / refill prime cycle	1		CA\$ 0.00

Repair Story: Punch #1 (Line 3) - 07/08/2026: Drained oil, refilled spun a bunch and repeated 2 times topped up oil



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-01250WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	: Exhaust rebuild / DPF replacement	10.5		CA\$ 0.00

Repair Story: Punch #5 (Line 4) - 07/11/2026: remove broken down pipe and flex pipe, found dpf cannister was broken, remove all exhaust from turbo to left stack, remove right stack, install flex pipe from turbo to left stack
Punch #6 (Line 4) - 07/11/2026: Assisted in repairing exhaust.
Punch #9 (Line 4) - 07/16/2026: Removed dpf step cover. Removed skid plate under dpf. Removed the dpf. Cleaned all surfaces dpf seals to exhaust. Had to cut off skid plate bolts. Re welded bolts that were cut off. Removed the big flex pipe that was put in to avoid the DPF. Began installing new exhaust. Had to cut a couple pieces of flex pipe for the down pipe off the turbo and the split for the stacks. Installed exhaust system from turbo to stacks. All new gaskets and clamps. Installed passenger side stack. Re installed step cover. Tested for leaks. Seemed to be ok.
Punch #10 (Line 4) - 07/16/2026: Continued time from last story

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	: Full service + inspection	3.5		CA\$ 0.00

Repair Story: Punch #7 (Line 5) - 07/15/2026: Drained oil, changed oil and fuel filters. filled with 44L 5/50. changed engine air filters. greased and completed inspection. #2 axle diff leaking topped up 1/2L 75/90

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	: Boost / charge batteries	0.75		CA\$ 0.00

Repair Story: Punch #8 (Line 6) - 07/16/2026: Took service truck out to boost truck. Had to leave it charge the battery for a bit. Brought truck in and put on battery charger.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
7	Air System - Air Line Repair: Repair trailer emergency line	0.5		CA\$ 0.00

Repair Story: Punch #11 (Line 7) - 07/19/2026: Found emergency line ripped apart. Removed all lines as in bundle. Installed new blue,red and trailer cord in bundle

Parts:

Line:

SKU:	Part Name:	Quantity Used:	Total:
	385/65-22.5 steer tires cooper	2	\$1,384.58



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-01250WO

Closing Date

clamp	4	\$91.04
gasket	4	\$99.56
strap	2	\$151.18
clamp	2	\$338.6
gasket	2	\$130.68

Parts Total for Line: \$2195.64

Line: 4

SKU:	Part Name:	Quantity Used:	Total:
X007785	SealClamp	8	\$212.88
X007784		1	\$18.24

Parts Total for Line: \$231.12

Line: 5

SKU:	Part Name:	Quantity Used:	Total:
LF14000NN	Lube filter	1	\$54.63
FF5825NN	Fuel filter	1	\$74.12
FS20075	Fuel filter	1	\$37.95
5W40ROTELLA BULK	5W40 ROTELLA	44	\$374.88
AF4195	Air filter	2	\$211.64
OILSAMPLEKIT	OIL SAMPLE KIT BMP	1	\$15.16
75W90 TOTE	75W90 GEAR LUBE	1	\$11.9

Parts Total for Line: \$780.28

Labour Billed: CA\$ 0.00

Parts Total: \$3,207.04

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 3,207.04

Work Order Total after GST: CA\$ 3,367.39



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-01250WO

Closing Date

**The Following Wheels were removed. It is YOUR responsibility to ensure a re-torque
is completed within 250km**

Axle 1 Left Removed

Axle 1 Right Removed



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-01223WO

Closing Date Jul 13, 2026

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 24,964

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,115,189

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Diagnose and Advise - Charging System Issue: Replace Failed alt	1		CA\$ 0.00

Repair Story: Adam Kohler - 07/06/2026: Removed old, swapped over pulley and install on new, installed alt and tested, good to go

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
	alternator	1	\$358.05

Parts Total for Line: \$358.05

Labour Billed:CA\$ 0.00

Parts Total: \$358.05

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 358.05

Work Order Total after GST: CA\$ 375.95



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-01223WO

Closing Date Jul 13, 2026



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-01115WO

Closing Date Jul 13, 2026

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 24,838

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,108,165

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Backup Alarm Replace: Backup alarm diag	1		CA\$ 0.00

Repair Story: Evan Williams - 06/21/2026: Checked to see if reverse switch was working. it is, tested for power and ground at alarm. had both need alarm ordered.

Evan Williams - 06/23/2026: Removed old beeper. installed new and hooked up works,

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Body - Tool Box Repair: Repair driver side tool box latch	1		CA\$ 0.00

Repair Story: Evan Williams - 06/21/2026: Door latch is locked cant get key in. tried to drill out lock was not successful. latch needs to be drilled out when new one arrives to replace.

Evan Williams - 06/23/2026: Drilled out latch. moved all junk piled against and installed new. works.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Gauge Cluster Repair: Gauge cluster repair. repair speedo not working	1		CA\$ 0.00

Repair Story: Evan Williams - 06/22/2026: Had code for speed sensor. replaced sensor and cleared code, truck went for drive no engine light.



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-01115WO

Closing Date Jul 13, 2026

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Electrical - Gauge Cluster Repair: Gauge cluster repair. repair pyro not working	1		CA\$ 0.00
Repair Story: Evan Williams - 06/22/2026: Found broken fuse holder. replaced and installed new fuse. works				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Electrical - GPS Tracking Service: GPS tracking device service / install.	1		CA\$ 0.00
Repair Story: Evan Williams - 06/23/2026: Removed old GPS. installed new with dash cam. set camera.				

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
82-2166		1	\$2.1
571.BU102		1	\$26.51

Parts Total for Line: \$28.61

Line: 2

SKU:	Part Name:	Quantity Used:	Total:
HLK2391		1	\$23.91

Parts Total for Line: \$23.91

Labour Billed: CA\$ 0.00

Parts Total: \$52.52

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 52.52

Work Order Total after GST: CA\$ 55.15



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-01115WO

Closing Date Jul 13, 2026



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00987WO

Closing Date Jul 13, 2026

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 24,629

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,097,244

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Service- Customer Truck Level 1: Truck Level 1	1.5		CA\$ 0.00
Repair Story: Cory Thorburn - 06/02/2026: finish service				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Body - Body Panel Repair: Body panel repair.	0		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Diagnose and Advise - Lights Inop: Headlight / marker / work light not working.	1		CA\$ 0.00
Repair Story: Tyson Waldner - 06/04/2026: Check all lights Found RR tail out Pig Tail was missing Get new pigtail and install, Middle Right Rear Marker on Headach rack dim took out look for new one did not have spoke to Larry he will have one for tomorrow				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00987WO

Closing Date Jul 13, 2026

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Body - Body Panel Repair: Body panel repair.	1		CA\$ 0.00
Repair Story: Tyson Waldner - 06/04/2026: Attempt to Straighten Left Work lamp hanger could no straighten found pipe and built new one				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Diagnose and Advise - Coolant Leak: Locate source of coolant leak.	0		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Air System - Repair Air Leak(s): Repair Air Leak(s), axle 1 left brake hose	0		CA\$ 0.00
Repair Story:				

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
81-0001-R	Gladhand Red	1	\$7.26
81-0001-B	Blue Gladhand	1	\$7.05

Parts Total for Line: \$14.31

Line: 3

SKU:	Part Name:	Quantity Used:	Total:
67090	PIGTAIL 3 PIN	1	\$2.13

Parts Total for Line: \$2.13

Labour Billed:CA\$ 0.00

Parts Total: \$16.44



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00987WO

Closing Date Jul 13, 2026

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 16.44

Work Order Total after GST: CA\$ 17.26



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00885WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 24,510

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,302,694

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Starter Motor Replace: Diag no start	2.5		CA\$ 0.00

Repair Story: Evan Williams - 05/20/2026: Drove to RTRC shop. found starter would click but not engage. tapped on starter and fired up. shut off but would not re start. needs starter.

Evan Williams - 05/21/2026: Brought truck in. turned off disconnects. unhooked cables and removed starter. installed new and hooked up all cables. tested operation. works as should.

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
	STARTER DELCO	1	\$649

Parts Total for Line: \$649.00

Labour Billed: CA\$ 0.00

Parts Total: \$649

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 649.00

Work Order Total after GST: CA\$ 681.45



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00885WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00723WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit:	1515	Serial Number:	1XKDP4TX8ER969355
Manufacturer:	Kenworth	Model:	T800
Year:	2014		
Hours:	24,373	KM's:	1,084,678

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Brakes - Brake Chamber Replace: replace broken brake pot #2 right	1.5		CA\$ 0.00
Repair Story: Cory Thorburn - 04/30/2026: replace broken #2 right brake pot, adjust brake				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Tires - Wheel Stud / Lug Replace: replace all drive axle wheel studs, inspect hubs rims etc.	10		CA\$ 0.00

Repair Story: Cory Thorburn - 04/30/2026: remove all drive wheels, remove all studs

Porter Dyer - 04/30/2026: Put truck in air, Removed wheels and drums and brakes and pounded wheel studs out of hubs on #3L, #2R, and #1 axle. Cleaned corroded areas on hubs.

Cory Thorburn - 04/30/2026: clean hubs found #2 left hub worn where rim sits, remove hub, replace both rims on #2 left, install all new stud in drive hubs, install brakes, clean drum mounting surface, clean rim mount surface, install all wheels torque to 500ft lbs, adjust all brakes

Evan Williams - 04/30/2026: Helped install wheel studs, brakes and cleaned all mounting surfaces of drums and wheels.



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00723WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Beacon / Strobe Replace: repair hood mounted strobe lights	9		CA\$ 0.00

Repair Story: Porter Dyer - 05/06/2026: Attempted replacing grill lights with grill in hood. Didn't work well. Removed grill from truck. Removed old lights from grill. Took a while to do without damaging anything. Porter Dyer - 05/06/2026: Installed new lights on grill. Wired them up. Secured wires well. Tested lights and they were wrong color. Will need to REDO.
Porter Dyer - 05/11/2026: Removed lights that were the wrong color. Everything took time on this job as everything is tiny and you have no room to work with. Installed new lights on grill, wired them all up, making sure to secure all wires and protect them on the grill. Tested lights all work good. Began re installing grill on truck.
Porter Dyer - 05/11/2026: Many bolts broke during removal, had to find correct stainless steel bolts to match. Had to find someone every time it was time to secure a bolt as i needed help i could not reach them. Installed, tested and it all works. Changed the sequence that the lights flashed so they would be as bright as possible and seen.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Electrical - Wiring Harness Repair: set up winch remote	1.75		CA\$ 0.00

Repair Story: Adam Kohler - 05/11/2026: Tried every procedure google had to offer, nothing worked, called manufacture and they asked what winch it had, checked can't find a plate, Jay text me another procedure, it works good to go
Adam Kohler - 05/11/2026: Tried every procedure google had to offer, nothing worked, called manufacture and they asked what winch it had, checked can't find a plate, Jay text me another procedure, it works good to go

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Body - Mud Flap Replace: Fix rear left mud flap	0.5		CA\$ 0.00

Repair Story: Adam Kohler - 05/06/2026: Drill out 2 fender whashers and rebolted on

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Tires - Wheel Replace: Put chrome back on	0.5		CA\$ 0.00

Repair Story: Adam Kohler - 05/05/2026: Reinstalled chrome lug nut covers



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00723WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
7	HVAC - Blower Motor Replace: DIAG AND FIX -BLOWER MOTOR NOT WORKING	1		CA\$ 0.00

Repair Story: Adam Kohler - 05/05/2026: checked truck for power and ground both present, tested motor on battery doesnt work, changed motor and cages, tested good to go

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
8	Electrical - Wiper Motor Replace: check wiper motor stops at any position	2		CA\$ 0.00

Repair Story: Evan Williams - 05/06/2026: Unhooked and removed wiper motor. installed new and hooked up. tested. did not fix issue.

Evan Williams - 05/07/2026: Removed steering wheel cover. plugged i test switch. wipers still stop random. put wheel cover back. checked fuses. found wiper fuse was missing. installed. work as should.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
9	Brakes - ABS Sensor Replace: truck abs light on, trailer abs comes on with any trailer attached,	0.5		CA\$ 0.00

Repair Story: Adam Kohler - 05/05/2026: Hooked up and scanned codes, cleared and drove around shop didn't come back

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
10	Diagnose and Advise - Coolant Leak: check for coolant leaks	1		CA\$ 0.00

Repair Story: Evan Williams - 05/06/2026: pressured up system. found upper rad hose clamp loose and heater hose manifold clamp loose. tightened clamps and cleaned off. no leaks. topped up coolant

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
	drive axle hub	1	\$670.25



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00723WO

Closing Date

	245 ALUM RIM	1	\$373.79
R006000A	WHEEL NUT	40	\$147.2
ZAJ3232951	BRAKE POT 30/30 WELDED CLEVIS	1	\$245.29
179.CP12	Clevis Pin 1/2"	1	\$0
FLTAW245825SPCAN	RIM 24.5	1	\$249
201.6247	STUD WHEEL	40	\$326.8
	CALLOUT	1	\$100

Parts Total for Line: \$2112.33

Line: 2

SKU:	Part Name:	Quantity Used:	Total:
	STROBE LIGHTS AMBER	1	\$37.99

Parts Total for Line: \$37.99

Labour Billed: CA\$ 0.00

Parts Total: \$2,150.32

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 2,150.32

Work Order Total after GST: CA\$ 2,257.84

The Following Wheels were removed. It is YOUR responsibility to ensure a re-torque is completed within 250km

Axle 2 Left Removed

Axle 3 Left Removed

Axle 4 Left Removed

Axle 2 Right Removed

Axle 3 Right Removed

Axle 4 Right Removed



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00690WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 24,338

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 108,314

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Service / PM - 250 Hour Service: 250 HR Service	4		CA\$ 0.00

Repair Story: Tyson Waldner - 04/26/2026: Do Service take oil Sample

Do Check over

Fix Right Upper Muffler Mount, HVAC Not Working, pull Blower Motor out Started working as soon as i moved it
 Blow all Dust, Dirt and Debris out Will need new blower Motor as will not start once stopped tidy up after work

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
LF14000NN	Lube filter	1	\$52.21
5W40ROTELLA BULK	5W40 ROTELLA	42	\$334.32
COOLANT BULK	COOLANT RED FLEET GUARD TOTE	6	\$20.1
M136001KUB	STACK MOUNT KIT- POLY	1	\$27.22
M13109	STACK BUSHING - KW	1	\$18.01
OILSAMPLEKIT	OIL SAMPLE KIT BMP	1	\$20.16
	BLOWER MOTOR	1	\$214.83
	CAGES	2	\$62.8

Parts Total for Line: \$749.65



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00690WO

Closing Date

Labour Billed: CA\$ 0.00

Parts Total: \$749.65

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 749.65

Work Order Total after GST: CA\$ 787.13



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00681WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours:

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,143,970

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	General - Other (Specify in Detail): opened to capture sublet for repair in hinton	0		CA\$ 0.00

Repair Story:

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
		1	\$1,281.97

Parts Total for Line: \$1281.97

Labour Billed:CA\$ 0.00

Parts Total: \$1,281.97

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 1,281.97

Work Order Total after GST: CA\$ 1,346.07



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00681WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00638WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 24,221

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,076,415

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Intake - Charge Air Tubing / Boots Replace: Replace broken charge pipe	1		CA\$ 0.00

Repair Story:

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
	Turbo elbow	1	\$209.25

Parts Total for Line: \$209.25

Labour Billed:CA\$ 0.00

Parts Total: \$209.25

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 209.25

Work Order Total after GST: CA\$ 219.71



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00638WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00585WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 24,173

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,073,677

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Tires - Tire Replace: replace #2-3 axle tires	2.5		CA\$ 0.00
Repair Story: jacked up removed all tires. swapped new rubber re installed on truck.				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Body - Fender Repair: replace fenders	2		CA\$ 0.00
Repair Story: removed old fenders. drilled new and installed.				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Telematics Device Replace: install gps and dash cam	1		CA\$ 0.00
Repair Story: removed old gps. installed new and ran wiring for dash cam. mounted.				

Parts:

Labour Billed:CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00585WO

Closing Date

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00508WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 24,055

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,068,465

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Service / PM - 250 Hour Service: 250 hr service	1.5		CA\$ 0.00

Repair Story: Evan Williams - 03/27/2026: drained oil, changed oil filter and fuel filters. filled with oil. greased and completed inspection.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Electrical - Starter Motor Replace: Repair intermittent no start	1		CA\$ 0.00

Repair Story: Evan Williams - 03/27/2026: unhooked starter, found positive post broken. removed starter and replaced. hooked up and tested. starts every time.

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
	11R24.5 DRIVE TIRES- IRON HEAD IDW 330	8	\$2,970.32
LF14000NN	Lube filter	1	\$52.21
5W40ROTELLA BULK	5W40 ROTELLA	48	\$382.08
FF5825NN	Fuel filter	1	\$74.12
FS20075	Fuel filter	1	\$37.71



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00508WO

Closing Date

OILSAMPLEKIT	OIL SAMPLE KIT BMP	1	\$20.43
--------------	--------------------	---	---------

Parts Total for Line: \$3536.87

Line: 2

SKU:	Part Name:	Quantity Used:	Total:
6924N- SEE DELCO 8200308	STARTER	1	\$382.69

Parts Total for Line: \$382.69

Labour Billed:CA\$ 0.00

Parts Total: \$3,919.56

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 3,919.56

Work Order Total after GST: CA\$ 4,115.54



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00452WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 23,941

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Tires - Tire Replace: repair blown steer	4		CA\$ 0.00

Repair Story: Evan Williams - 03/16/2026: drove from Sherwood park to Cameron heights. jacked up truck and removed old tire. installed new with rim. torqued , drove back to shop.

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
	RIM DISHED 22.5- STEER	1	\$693
	385/65R22.5 IRONHEAD 402 STEER TIRE	2	\$1,101.28

Parts Total for Line: \$1794.28

Labour Billed: CA\$ 0.00

Parts Total: \$1,794.28

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 1,794.28

Work Order Total after GST: CA\$ 1,883.99



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00452WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00385WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 23,829

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Body - Fender Repair: replace fenders	1		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: install missing chrome	0		CA\$ 0.00
Repair Story:				

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
	23 SQ FT 3/16 ALUM CHK	2	\$395.5

Parts Total for Line: \$395.50

Labour Billed:CA\$ 0.00

Parts Total: \$395.5

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 395.50



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00385WO

Closing Date

Work Order Total after GST: CA\$ 415.28



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00317WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 23,829

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,058,834

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Service / PM - CVIP / DOT Inspection: CVIP Inspection	1		CA\$ 0.00
Repair Story: Adam Kohler - 02/25/2026: Completed inspection and installed sticker				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00317WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00293WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 23,810

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,058,027

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Engine - Oil and Filter Service: Service and inspect	2.5		CA\$ 0.00

Repair Story: Adam Kohler - 02/19/2026: Made wo

Evan Williams - 02/19/2026: drained oil, changed filter. greased truck and completed inspection. filled with oil.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Electrical - Two-Way Radio Repair: replace 2 way mount	1.5		CA\$ 0.00

Repair Story: Evan Williams - 02/19/2026: unhooked and removed radio, removed broken mount. installed new and mounted radio to it.

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
LF14000NN	Lube filter	1	\$54.63
5W40ROTELLA BULK	5W40 ROTELLA	44	\$350.24

Parts Total for Line: \$404.87



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00293WO

Closing Date

Labour Billed: CA\$ 0.00

Parts Total: \$404.87

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 404.87

Work Order Total after GST: CA\$ 425.11



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00024WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 23,550

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,047,599

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Backup Alarm Replace: Diag why backup alarm isnt working.	2		CA\$ 0.00

Repair Story: Porter Dyer - 01/07/2026: Found broken wires. Repaired that section of wires. Found the alarm was not working still. Tested found it was no good. Replaced alarm.
Porter Dyer - 01/08/2026: Drilled new holes for mounting alarm. Installed with new bolts.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: Change out leaking wheel seals axle 2 left and right	4.5		CA\$ 0.00

Repair Story: Porter Dyer - 01/07/2026: Took apart both hubs. Both were crazy gross full of grease. Took both hubs and drums to wash bay and washed out. Cleaned around the spiders of the unit. Took brakes off and threw away due to oil on them.
Porter Dyer - 01/08/2026: Installed new wheel seals and installed hubs. Used proper torque procedure. Added oil to hubs once they were all put together



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00024WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Engine - Belt Replace: Change out worn engine belt	0.5		CA\$ 0.00

Repair Story: Adam Kohler - 01/07/2026: Removed cracked belt installed new belt

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Software - Diagnostic Scan: Scan check engine	0.5		CA\$ 0.00

Repair Story: Adam Kohler - 01/07/2026: Scanned code got lift pump high voltage code but its inactive

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Cooling - Fan Hub Replace: Rebuild Fan clutch	12.5		CA\$ 0.00

Repair Story: Scott Dancy - 01/08/2026: remove freon from a/c. remove a/c pump, alt, fan hub, alt support bracket to remove broken bolt. installed heili coil. rebuilt fan hub, installed fan hub.

Scott Dancy - 01/09/2026: install frt housing. install alt, install a/c comp, filled with freon 4lbs 3oz

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Electrical - Wiring Harness Repair: Repair diff temp sensor wiring			CA\$ 0.00

Repair Story:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
7	: Change worn d-sign	2		CA\$ 0.00

Repair Story: Porter Dyer - 01/09/2026: Removed d sign

Cory Thorburn - 01/10/2026: trim new D sign, install D sign

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
8	: service and inspect	2		CA\$ 0.00

Repair Story: Evan Williams - 01/06/2026: completed service and grease. did not have time for inspection. getting CVI.



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00024WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
9	Electrical - Key Switch / Ignition Switch Replace: Change ignition and jockey box locks	1.5		CA\$ 0.00
Repair Story: Adam Kohler - 01/07/2026: Removed ignition and installed new, glues sticker down(acc., off, on , start) changed locks in jockey box and lubes everything up				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
10	Service / PM - CVIP / DOT Inspection: CVIP Inspection	2.5		CA\$ 0.00
Repair Story: Adam Kohler - 01/07/2026: Made WO Porter Dyer - 01/07/2026: Took all measurements for cvi. Learnt about inspecting other things on the unit for future. Topped up all the tires on truck as well. Not crazy low but around that 10 psi below mark. All topped up now.				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
11	Service / PM - CVIP / DOT Inspection: CVIP Wheel Pull	5		CA\$ 0.00
Repair Story: Porter Dyer - 01/07/2026: Pulled all 4 axles of wheels off. Put 3 back on today. Porter Dyer - 01/08/2026: Installed wheels on axle #2 after finishing hubs. Porter Dyer - 01/12/2026: Set all brakes, torqued all wheels. Tourqe tag in cab. Marked all lugs with marker.				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
12	Electrical - Marker / Clearance Light Replace: Replace remaining clearance lights	1		CA\$ 0.00
Repair Story: Adam Kohler - 01/07/2026: Changed remaining clearance lights so all match now				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00024WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
13	Electrical - Wiring Harness Repair: Diag and fix dim headache rack lights	7		CA\$ 0.00

Repair Story: Porter Dyer - 01/08/2026: Traced wiring back to junction box. Found the power wire for running lights wasn't putting much out. Traced that power wire to a j box in the rear of truck to find a bad corroded mess. Running lights didn't work on the end of the truck at all. Had to cut out grill on top of junction box to gain access to electrical. Crimped a new connection and lights are working as per usual now.

Porter Dyer - 01/09/2026: The junction box where the power was coming from was very corroded. All terminals were in rough shape. We decided to go ahead and replace junction box. Removed box and wires. Due to wires being corroded and having to cut them i had to extend a hand full of wires so it would reach the box. Installed new terminals on the ends and put all together. Had to remove rig mat supports on truck to get access to panel. Had to remove a mesh panel over top of the rear junction box to get too. Grinded bolts off to get to it. After bolts were grinded i had to extract them out due to nuts welded on bottom of brackets. Put both objects back together once job was done and tested lights.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
14	Diagnose and Advise - Air Leak (Truck Air System): Diag. air leak at d-sign	0.5		CA\$ 0.00

Repair Story: Adam Kohler - 01/07/2026: Tried to get it to leak again, seems good

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
15	Cab - Window Replace - Windshield: Change left windshield			CA\$ 0.00

Repair Story:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
16	Hydraulics - Quick Coupler Replace: install hyd whip hoses and couplings.	1.5		CA\$ 0.00

Repair Story: Scott Dancy - 01/07/2026: remove seized coupling, installed new couplings on truc. install new whip hose and couplings.



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00024WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
17	Electrical - Sensor Replace - Generic: Replace axle 3 diff temp sensor	2		CA\$ 0.00

Repair Story: Porter Dyer - 01/09/2026: Changed diff sensor. Seen axle #2 diff fill plug leaking. Pulled it out taped it up and put back in.

Porter Dyer - 01/12/2026: Computer still reading open circuit after replacing temp sensor. Traced the wires back and found a section with corrosion and broken wires. Cut out that section cleaned up and re crimped. Fixed the issue.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
18	Drivetrain - Differential Rebuild: Rebuild both inter axle locks	0.5		CA\$ 0.00

Repair Story: Cory Thorburn - 01/10/2026: reseal diff locks

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
19	HVAC - AC Compressor Replace: Extract broken bolt from accessory bracket and install ac compressor			CA\$ 0.00

Repair Story:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
20	Brakes - Brake Shoe / Pad Replace: Install new brake shoes on axle # 2 both wheel ends.	0.5		CA\$ 0.00

Repair Story: Porter Dyer - 01/08/2026: Installed new brake shoes on 2nd axle due to them being shot from oil getting in em.



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00024WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
21	Attachment - 5th Wheel Slide Repair: r/r 5th wheel and slide.	13		CA\$ 0.00
Repair Story: J. P. Allemand - 01/08/2026: cut some welds on fifth wheel slider rails, replace a piece of mesh on the back Scott Dancy - 01/09/2026: removed broken bolts from 5th wheel slide mount. cut some welds off, pry up slide, to remove from truck with skid steer. remove broken bolts, clean rust off for new slide and wheel. J. P. Allemand - 01/11/2026: fix 2 cracks ,bolt on new fifth wheel, stitch on , straighten an angle iron make a new bracket, paint bracket and new mesh				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
22	Brakes - ABS Sensor Replace: Replace axle #4 right abs sensor.	1.5		CA\$ 0.00
Repair Story: Porter Dyer - 01/12/2026: Jacked up axle, took wheels and drum off. Disconnected abs line and removed. Installed new one, ties down and tested. Re installed wheels and drum				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
23	Suspension - Air Bag Level Valve Replace: Install ride height valve	1.5		CA\$ 0.00
Repair Story: Porter Dyer - 01/12/2026: Removed old ride height valve and connections. Installed new push in air fittings on new valve. Mounted valve on truck and connected line. The bolts on the linkage broke during installation. Used new hardware and installed. tested and worked.				

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
	LOCK SET	1	\$361.28

Parts Total for Line: \$361.28

Line: 5

SKU:	Part Name:	Quantity Used:	Total:
	FENDERS30X50.25 AND 30X49.75	4	\$1,078.52

Parts Total for Line: \$1078.52

Line: 6



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00024WO

Closing Date

SKU:	Part Name:	Quantity Used:	Total:
LF14001NN	FILTER LUBE	1	\$67.57
FF5825NN	Fuel filter	1	\$74.12
FS20075	Fuel filter	1	\$37.71
5W40ROTELLA BULK	5W40 ROTELLA	44	\$350.24

Parts Total for Line: \$529.64

Line: 8

SKU:	Part Name:	Quantity Used:	Total:
	COMPRESSOR	2	\$1,062.8
3093936CUM	BOLT TENSIONER MOUNTING	1	\$20.26
89440	TENSIONER ASSEMBLY	1	\$173.45
FLTP20	WIPER-20INCH	2	\$19.22

Parts Total for Line: \$1275.73

Line: 14

SKU:	Part Name:	Quantity Used:	Total:
	DIFF TEMP SENSOR Q21-002	1	\$142.29

Parts Total for Line: \$142.29

Line: 17

SKU:	Part Name:	Quantity Used:	Total:
	RIDE VALVE 171H184	2	\$142.08
	INTER AXLE LOCK KIT 512892ETN	2	\$90.1

Parts Total for Line: \$232.18

Line: 18

SKU:	Part Name:	Quantity Used:	Total:
	7/16 FINE BOLTS AND WASHERS	2	\$4.8
	FW35J948XL00 5TH WITH 48" RAILS	1	\$4,825.67
4925884CUM	BOLT TENSIONER MOUNTING	1	\$6.42

Parts Total for Line: \$4836.89

Line: 19

SKU:	Part Name:	Quantity Used:	Total:
15961	JUNCTION BOX	1	\$28.54
571.BU97	BACK UP ALARM	1	\$26.51



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2026-00024WO

Closing Date

Parts Total for Line: \$55.05

Line: 20

SKU:	Part Name:	Quantity Used:	Total:
392-9131	Wheel Seals	2	\$139.28
33033106	GASKET DRIVE AXLE	2	\$5.92
4709	Shoes brake	2	\$135.7

Parts Total for Line: \$280.90

Line: 23

SKU:	Part Name:	Quantity Used:	Total:
171.H218	VALVE RIDE CONTROL	1	\$109.07

Parts Total for Line: \$109.07

Labour Billed:CA\$ 0.00

Parts Total: \$8,901.55

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 8,901.55

Work Order Total after GST: CA\$ 9,346.63

The Following Wheels were removed. It is YOUR responsibility to ensure a re-torque is completed within 250km

Axle 1 Left Removed

Axle 2 Left Removed

Axle 3 Left Removed

Axle 4 Left Removed

Axle 1 Right Removed

Axle 2 Right Removed

Axle 3 Right Removed

Axle 4 Right Removed



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02243WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit:	1515	Serial Number:	1XKDP4TX8ER969355
Manufacturer:	Kenworth	Model:	T800
Year:	2014		
Hours:	23,373	KM's:	1,040,615

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Engine - Belt Tensioner Replace: replace ac belt tensioner	0.5		CA\$ 0.00
Repair Story: Cory Thorburn - 12/17/2025: replace ac belt tensioner, install new ac belt				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Electrical - Beacon / Strobe Replace: Diag and fix beacons, marker light	4.5		CA\$ 0.00
Repair Story: Adam Kohler - 12/17/2025: Tested power and ground, had weak power, unhooked and retested Good power now, Changed beacons works Tyson Waldner - 12/17/2025: Marker light out Left side drag and rewire				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Marker / Clearance Light Replace: Change Roof clearance lights that are burnt out	1		CA\$ 0.00
Repair Story: Adam Kohler - 12/17/2025: Removed old and installed new lights				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02243WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Electrical - Heated Mirror Repair: Diag poor left side mirror heat	1.5		CA\$ 0.00

Repair Story: Adam Kohler - 12/17/2025: Checked wiring for brakes, found none, turned on and checked heat convex are good, both mirrors are slow but working

Parts:

Line: 0

SKU:	Part Name:	Quantity Used:	Total:
	HOSE ASSEMBLY	1	\$735.72

Parts Total for Line: \$735.72

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
638K6BLT	BELT	1	\$29.73
89448	TENSIONER ASSEMBLY	1	\$183.73

Parts Total for Line: \$213.46

Line: 2

SKU:	Part Name:	Quantity Used:	Total:
15-720	Trailer Plug	1	\$23.61
E-2110AC	9 3/4" LED WARNING LIGHT BAR	2	\$519.2

Parts Total for Line: \$542.81

Line: 3

SKU:	Part Name:	Quantity Used:	Total:
	CAB LIGHT 571LD322A171	6	\$175.8

Parts Total for Line: \$175.80

Labour Billed: CA\$ 0.00

Parts Total: \$1,667.79

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 1,667.79

Work Order Total after GST: CA\$ 1,751.18



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02243WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02225WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 23,309

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,037,724

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Battery Replace: install battery charger	1		CA\$ 0.00
Repair Story: Cory Thorburn - 12/12/2025: install battery charger, wire into block heater				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02225WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02186WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit:	1515	Serial Number:	1XKDP4TX8ER969355
Manufacturer:	Kenworth	Model:	T800
Year:	2014		
Hours:	23,291	KM's:	1,037,058

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: service and inspect	1.5		CA\$ 0.00
Repair Story: Evan Williams - 12/07/2025: completed service and inspection				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Cab - Mirror Replace: fix DS mirror heat	0.5		CA\$ 0.00
Repair Story: Evan Williams - 12/07/2025: found mirror heat not working. had power. replaced mirror works				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Fuel - Fuel Tank Cleaning: repair fuel not equalizing	0.5		CA\$ 0.00
Repair Story: Evan Williams - 12/07/2025: found tank vent frozen. removed ice and cleaned.				

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
LF14000NN	Lube filter	1	\$54.63
5W40ROTELLA BULK	5W40 ROTELLA	48	\$382.08



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02186WO

Closing Date

Parts Total for Line: \$436.71

Line: 2

SKU:	Part Name:	Quantity Used:	Total:
FLTMIR4012	8 1/2" CONVEX MIRROR	1	\$64.95

Parts Total for Line: \$64.95

Labour Billed:CA\$ 0.00

Parts Total: \$501.66

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 501.66

Work Order Total after GST: CA\$ 526.74



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02153WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 23,260

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,034,739

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Key Switch / Ignition Switch Replace: Diag and fix no start	3		CA\$ 0.00

Repair Story: Adam Kohler - 12/03/2025: Jumped starter and brought in, tried multiple times worked some times, sometimes it didn't, put a test light on signal wire found it wasn't always getting signal, ordered ignition, jumped straight to power and some times it would work others it wouldn't installed new starter it works now

Parts:

Line: 0

SKU:	Part Name:	Quantity Used:	Total:
	IGNITION SWITCH P27-1048	1	\$96.74
	LOCK KIT R56-1065-03000	1	\$367.88

Parts Total for Line: \$464.62

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
6924N- SEE DELCO 8200308	STARTER	1	\$382.69

Parts Total for Line: \$382.69



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02153WO

Closing Date

Labour Billed: CA\$ 0.00

Parts Total: \$847.31

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 847.31

Work Order Total after GST: CA\$ 889.68



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02107WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 23,149

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,028,862

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Engine - Oil and Filter Service: service unit.	1		CA\$ 0.00
Repair Story: Scott Dancy - 11/26/2025: change engine oil filter, and added 4liters engine oil.				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Tires - Tire Repair (Plug / Patch): repair flat.	2		CA\$ 0.00
Repair Story: Scott Dancy - 11/26/2025: remove tire repair flat and install tire torque to spec.				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Tires - Tire Repair (Plug / Patch): check all tire pressures.	1		CA\$ 0.00
Repair Story: Scott Dancy - 11/26/2025: check all tire pressures all low topped up.				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02107WO

Closing Date

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02005WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours: 22,936

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's: 1,020,069

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Drivetrain - Differential Rebuild: repair for axle 2 diff failure, front drive	23.5		CA\$ 0.00

Repair Story:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Electrical - Wiper Motor Replace: replace wiper motor	1.5		CA\$ 0.00

Repair Story:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Sensor Replace - Generic: repair all diff temp and lock sensor switches as needed	2		CA\$ 0.00

Repair Story:



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02005WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Cab - Door Latch / Handle Replace: replace driver door latch			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Drivetrain - Differential Service / Fluid Change: drain and refill axle 3 and 4 diff oils sample and inspect for any debris.	2		CA\$ 0.00
Repair Story:				

Parts:

Line: 0

SKU:	Part Name:	Quantity Used:	Total:
	DD170PCC DIFF CORE DAMAGE	1	\$2,325

Parts Total for Line: \$2325.00

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
	R23-1040 MOTOR ASSEMBLY	1	\$508.43
	1052822 HARNESS HORN CONVERSION	3	\$106.02
	SS5035 SENDER TEMP	3	\$292.2
392-9131	Wheel Seals	2	\$127.44
	DIFF	1	\$4,966.92
	CORE DIFF	1	\$3,100
	BEARING	1	\$167.8
	OUTPUT SHAFT	1	\$423.88
	SET403 BRG	2	\$169.82
	U JOINT 2503X	1	\$249.3
	SET401 BRG	2	\$155.8
	SEAL PINION 210737	2	\$104.26

Parts Total for Line: \$10371.87



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-02005WO

Closing Date

Labour Billed: CA\$ 0.00

Parts Total: \$12,696.87

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 12,696.87

Work Order Total after GST: CA\$ 13,331.71



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01980WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 22,890

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,018,290

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Cab - Window Replace - Windshield: Change out broken windshields	3.5		CA\$ 0.00

Repair Story: Adam Kohler - 11/05/2025: fixed
Evan Williams - 11/05/2025: helped with windshields.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: Finish service	1		CA\$ 0.00

Repair Story: Evan Williams - 11/05/2025: completed inspection

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01980WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01958WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 22,850

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: service	1		CA\$ 0.00
Repair Story: Evan Williams - 11/02/2025: completed service, no time for inspection				

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
X007785	SealClamp	2	\$37.72

Parts Total for Line: \$37.72

Labour Billed:CA\$ 0.00

Parts Total: \$37.72

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 37.72

Work Order Total after GST: CA\$ 39.61



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01958WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01931WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 22,824

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 1,017,912

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Exhaust - Exhaust Pipe Replace: Install new flange on turbo	4		CA\$ 0.00
Repair Story: Adam Kohler - 10/31/2025: Made WO Porter Dyer - 10/31/2025: Disassembled and re assembled after flange was welded. J. P. Allemand - 10/31/2025: weld a flange on a exhaust pipe Evan Williams - 10/31/2025: Helped Porter Alline exhaust.				

Parts:

Line:

SKU:	Part Name:	Quantity Used:	Total:
	5TH WHEEL SLIDE AIR LINE	1	\$22.77
	LH DOOR LATCH	1	\$276.01

Parts Total for Line: \$298.78

Labour Billed:CA\$ 0.00

Parts Total: \$298.78

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 298.78

Work Order Total after GST: CA\$ 313.72



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01931WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01812WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 22,639

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: mid life service, inspection.	1.5		CA\$ 0.00
Repair Story: Evan Williams - 10/14/2025: completed service, changed oil filter and topped up. and inspection				

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
LF14000NN	Lube filter	1	\$54.63

Parts Total for Line: \$54.63

Labour Billed:CA\$ 0.00

Parts Total: \$54.63

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 54.63

Work Order Total after GST: CA\$ 57.36



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01812WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01593WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 22,350

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 992,646

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Service and Inspect	3		CA\$ 0.00
Repair Story: Adam Kohler - 09/12/2025: change oil, oil filter, fuel filters, greased unit, completed LVL 2				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01467WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 22,164

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 981,500

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Engine - Oil and Filter Service: Change oil filter	1		CA\$ 0.00
Repair Story: Adam Kohler - 08/28/2025: Changed oil filter and topped up oil, inspected unit				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Exhaust - Exhaust Clamp / Hanger Replace: Fix Exhaust	0.5		CA\$ 0.00
Repair Story: Adam Kohler - 08/28/2025: Removed old clamp, cleaned sealing surface and installed new gasket and clamp				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Starter Motor Replace: Change starter	1.5		CA\$ 0.00
Repair Story: Evan Williams - 08/28/2025: disconnected batteries. unhooked starter and removed. installed new				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01467WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Electrical - Backup Alarm Replace: Fix back up alarm	2		CA\$ 0.00
Repair Story: Adam Kohler - 08/28/2025: Changed broken alarm, still not working, checked power and ground, problem is in connector, wired ground direct				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Drivetrain - Lockup / Diff Lock Repair: Fix leaking diff lock	1		CA\$ 0.00
Repair Story: Adam Kohler - 08/28/2025: Tried everything couldn't here a leak				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Electrical - Headlight Replace: change head light buckets	2.5		CA\$ 0.00
Repair Story: Adam Kohler - 08/28/2025: Removed old bucket installed new and tested head head lights will need to be aimed				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
7	Brakes - Brake Shoe / Pad Replace: change worn brake shoes axle 3 right	1.5		CA\$ 0.00
Repair Story: Evan Williams - 08/28/2025: jacked up. removed wheels. removed drum and old brakes. installed new brakes and drum. installed tires and set brakes.				

Parts:

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
LF14000NN	Lube filter	1	\$54.63
5W40ROTELLA BULK	5W40 ROTELLA	44	\$327.8

Parts Total for Line: \$382.43

Line: 2

SKU:	Part Name:	Quantity Used:	Total:
------	------------	----------------	--------



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01467WO

Closing Date

2866636	Gaskets	1	\$23.49
90-0013	Clamps	1	\$19.8

Parts Total for Line: \$43.29

Line: 3

SKU:	Part Name:	Quantity Used:	Total:
6924N- SEE DELCO 8200308	STARTER	1	\$382.69

Parts Total for Line: \$382.69

Line: 4

SKU:	Part Name:	Quantity Used:	Total:
	5394261 DIFF TEMP REAIR CONNECTOR	5	\$400.05
571.BU97	BACK UP ALARM	1	\$26.51
TLED-OBMR	RED 6" LIGHT	1	\$19.44

Parts Total for Line: \$446.00

Line: 7

SKU:	Part Name:	Quantity Used:	Total:
4709	Shoes brake	1	\$175.41

Parts Total for Line: \$175.41

Labour Billed:CA\$ 0.00

Parts Total: \$1,429.82

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 1,429.82

Work Order Total after GST: CA\$ 1,501.31



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01467WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01445WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 22,091

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 977,649

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Sensor Replace - Generic: replace oil pressure sensor	0.5		CA\$ 0.00

Repair Story: Cory Thorburn - 08/23/2025: install new oil pressure sensor

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01445WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01410WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 22,038

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Cab - Mirror Replace: Replace mirror	1		CA\$ 0.00
Repair Story: Evan Williams - 08/17/2025: removed mirror installed ne wand wired in				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01410WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01304WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,899

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 968,778

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Tires - Tire Replace: Change steer tires	3		CA\$ 0.00
Repair Story: Adam Kohler - 07/31/2025: Removed old installed new				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01304WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01279WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,886

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 968,207

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Service / PM - 500 Hour Service: 500 HR SERVICE AND LEVEL1	1.5		CA\$ 0.00

Repair Story: Jason Cordel - 07/27/2025: DRAIN ENGINE OIL AND FILTER, REPLACE FUEL FILTERS, INSTALL NEW OIL FILTER, FILL WITH OIL RUN UNIT AND TOP UP, GREASE,

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Brakes - Brake Chamber Replace: REPLACE FAILED BRAKE POT AXLE 3 RIGHT	1		CA\$ 0.00

Repair Story: Jason Cordel - 07/27/2025: REMOVE FAILED BRAKE CHAMBER, GET NEW ONE AND INSTALL, SET BRAKE.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Body - Tool Box Repair: Install new tool box	4		CA\$ 0.00

Repair Story: Cory Thorburn - 07/29/2025: remove old tool box, cut mount move over weld back together, install new tool box

Parts:



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01279WO

Closing Date

Line: 0

SKU:	Part Name:	Quantity Used:	Total:
	31-72184 TOOL BOX	1	\$340.75

Parts Total for Line: \$340.75

Line: 1

SKU:	Part Name:	Quantity Used:	Total:
LF14000NN	Lube filter	1	\$54.51
FF5825NN	Fuel filter	1	\$68.88
Tote 5W40	5W40 tote mobil	44	\$292.6

Parts Total for Line: \$415.99

Line: 2

SKU:	Part Name:	Quantity Used:	Total:
FLT3030SCB20	Brake pot 3030	1	\$44.95

Parts Total for Line: \$44.95

Labour Billed:CA\$ 0.00

Parts Total: \$801.69

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 801.69

Work Order Total after GST: CA\$ 841.77



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01242WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,833

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 964,991

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Cooling - Thermostat Replace: engine overheat.	6.5		CA\$ 0.00
Repair Story: Scott Dancy - 07/21/2025: remove cac cleaned rad, cac, condenser. installed cac, test ran found tstat not opening, order tstat. Scott Dancy - 07/21/2025: r/r tstat, fill with coolant. test run t stat opens at 180 good, fan kicks in at 210 good, engine cools down to 178 good, then begins heat cycle again. all good.				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01242WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01128WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,619

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Mid life oil filter	0		CA\$ 0.00
Repair Story: null - : 1				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Diagnose and Advise - Stalling / Dying: Diag. and Fix fuel issue	1		CA\$ 0.00
Repair Story: Tyson Waldner - 07/03/2025: Go to truck Diag Fuel iss ue Fuel Bowl had no fuel Primed system and could see there were air bubbles coming through told driver to get to shop once at shop i swapped the new bowl of R1504 and put it on 1515 all better bowl must have been slightly cracked, spun oil filter off for mid life and spun new one on				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01128WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01096WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,547

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 951,259

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Diagnose and Advise - General Inspection / Walkaround: quick check inspection	0.5		CA\$ 0.00

Repair Story: Jeff Franklin - 06/27/2025: complete a quick check inspection

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Exhaust - Exhaust Pipe Replace: find exhaust leak	2.5		CA\$ 0.00

Repair Story: Jeff Franklin - 06/27/2025: find exhaust leak, cut and remove flex pipe after turbo down pipe, clean up all joints ready for new pipe, pick out clamps and gasket needed for repair
Jeff Franklin - 06/28/2025: cut and place flex pipe, install new clamps and gasket
still has exhaust leak tho, muffler under right step is leaking around joints



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-01096WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Worklight Replace: fix lights	1.5		CA\$ 0.00
Repair Story: Jeff Franklin - 06/27/2025: check power and ground on marker left side rack step, remove and replace pigtail and light Jeff Franklin - 06/28/2025: remove broken winch work light, relocate to center above winch and run new wiring, tie up and test				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00924WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,473

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 947,196

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: leaking axle gaasket	1		CA\$ 0.00
Repair Story: Evan Williams - 06/07/2025: found leaking from bolt. tightened and torqued all. cleaned no leak				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00908WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,473

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 97,195

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Fuel - Injector Replace - Single: fuel leak around fuel lines.	2		CA\$ 0.00

Repair Story: Scott Dancy - 06/05/2025: cleaned fuel off engine, ran engine found #3 inj tube leaking. replaced #4 and 33 inj tubes.

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00908WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00828WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,365

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 942,558

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Fuel - Injector Replace - Single: #3 injector line leaking external	1.25		CA\$ 0.00

Repair Story: Scott Dancy - 05/22/2025: cleaned fuel side of engine ran engine found #3 inj tube leaking. remove tube and clean inspect all good reinstall. test run no leaks.

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00828WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00812WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,360

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 942,381

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Diagnose and Advise - Fuel Leak: Fuel leak	0.5		CA\$ 0.00
Repair Story: Tyson Waldner - 05/19/2025: search for fuel leak noting found at this time				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: service	1.5		CA\$ 0.00
Repair Story: Tyson Waldner - 05/19/2025: Change oil, Filter, fuel Filter , take oil Sample				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00812WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00704WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,262

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 936,927

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Software - Calibration / Parameter Set: change cruise to 71mph	0.5		CA\$ 0.00

Repair Story: Adam Kohler - 05/02/2025: Changed cruise form 68 mph to 71 mph

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Tires - Tire Replace: Change axle 2 tires	2.25		CA\$ 0.00

Repair Story: Adam Kohler - 05/02/2025: CHanged axle 2 tires

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00704WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00631WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 15,949

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 781,397

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Tires - Tire Repair (Plug / Patch): Repair tire	0.5		CA\$ 0.00
Repair Story: Adam Kohler - 04/23/2025: found leak and installed plug, aired up tire				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00631WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00565WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 21,091

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Fuel - Injector Replace - Single: Engine light	3		CA\$ 0.00

Repair Story: Tyson Waldner - 04/07/2025: Diag Engine Light Injector 3 Driver not Communicating Check Wiring take Valve Cover off check wiring in there clear Code and Send

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	HVAC - Heater Control Valve Replace: Bunk HTR Core, Coolant Leaks	3		CA\$ 0.00

Repair Story: Tyson Waldner - 04/07/2025: take Bunk apart go to take Htr Core out Found Core was not leaking coolant leak is coming out of control valve put Ball valve in to shut coolant off to Core pressure system and fix other leaks run truck out side and check

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	: mid service	0.5		CA\$ 0.00

Repair Story: Cory Thorburn - 04/10/2025: replace oil filter, top up oil



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00565WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Fuel - Injector Replace - Single: install Injector #3	1.5		CA\$ 0.00
Repair Story: Tyson Waldner - 04/13/2025: find Procedure on Quick serve clean off valve Cover area Follow Procedure for Disassembly, and Reassembly				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	HVAC - Heater Control Valve Replace: Bunk Heat Control Valve Leaking	1.5		CA\$ 0.00
Repair Story: Tyson Waldner - 04/13/2025: rip Bunk apart disconnect lines and Replace valve then Verify not leaking				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00444WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 20,899

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 918,363

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	General - Custom Fabrication / Build: Build chain cover	1.5		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Electrical - Sensor Replace - Generic: Check diff temp sensors/pig tails order as needed	0.5		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Drivetrain - Lockup / Diff Lock Repair: check diff locks	1.5		CA\$ 0.00
Repair Story:				

Parts:

Labour Billed:CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00444WO

Closing Date

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00398WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515Welding ONLY

Manufacturer: Kenworth

Year: 2014

Hours: -1

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	General - Custom Fabrication / Build: mat bunks	9.5		CA\$ 0.00

Repair Story: Trey Albers - 03/10/2025: repaired bunks and modified

Trey Albers - 03/11/2025: mounted bunksback on

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00398WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00314WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 20,860

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 917,463

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Engine - Cylinder Head Replace: Remove Head for inspection	15		CA\$ 0.00
Repair Story: Adam Kohler - 03/03/2025: Removed hood for body shop, removed intake piping, removed rad pack, removed all wiring, removed head bolts and removed head. Jeff Franklin - 03/03/2025: help Adam remove hood, remove both fenders, remove valve cover, remove fuel lines and quail tubes, remove injectors, remove rocker arms and jake heads, use 1502 and remove head Jeff Franklin - 03/04/2025: scrape off old gasket, polish and clean up ready for new liner Cory Thorburn - 03/03/2025: drain oil, remove oil pan, remove #1 piston				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00314WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Engine - Cylinder Head Replace: Install new liner, piston and rod into cylinder 1, install head	50.25		CA\$ 0.00

Repair Story: Adam Kohler - 03/04/2025: Tried to install liner without o-ring to measure parturition wouldn't go down far enough, measured new and old and found that the liner was to big, ran to on-track and got correct liner, installed and measured, was good, installed o-ring lubed with soap and installed remeasured was good, so put together rod and piston, installed rings, oiled and installed
Jeff Franklin - 03/04/2025: head to back shed and go through spare engine parts, bring up good used rod, clean up parts and install new piston head, work with Adam to set liner and check protrusion, found it was wrong liner, remove liner, clean oil pan and polish surfaces ready for install, install new liner, help with piston install, torque rod bolts to spec in sequence required, Cory
Thorburn - 03/04/2025: help install new piston
Cory Thorburn - 03/04/2025: install oil pan, remove oil pan install #1 piston oil jet, install oil pan torque to spec
Adam Kohler - 03/06/2025: Installed oil cooler, Installed turbo, changed drain line
Scott Dancy - 03/05/2025: cleaned reman head, got head ready for installation.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Exhaust - Exhaust Pipe Replace: Build exhaust	8		CA\$ 0.00

Repair Story: Adam Kohler - 03/07/2025: Measured, tacked, cut and installed custom exhaust

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Drivetrain - Clutch Adjustment: adjust clutch	1		CA\$ 0.00

Repair Story:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Electrical - Tail Light Replace: Install and wire in new light covers	2		CA\$ 0.00

Repair Story:



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00314WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Engine - PCV / Crankcase Vent Replace: replace crank case filter drain tube	1		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
7	General - Equipment Transport: pick up unit from Nisku	2.5		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
8	Body - Hood Repair: Hood and Fenders	5		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
9	Cab - Mirror Replace: Driver Mirror and passenger convex mirror	1.5		CA\$ 0.00
Repair Story:				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00314WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00204WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515Welding ONLY

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	General - Custom Fabrication / Build: built mat bunks	6		CA\$ 0.00
Repair Story: Trey Albers - 01/11/2025: built mat bunks				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	General - Custom Fabrication / Build: installing mat bunks	15.5		CA\$ 0.00
Repair Story: Trey Albers - 02/08/2025: started putting on mat bunks Trey Albers - 02/09/2025: finished putting on mat bunks and cutting off old pockets				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00204WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00166WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Battery Replace: replace batteryys			CA\$ 0.00
Repair Story: all completed by tyson but no time				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: complete service			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Drivetrain - PTO Service / Repair: repair pto light			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Cab - Mirror Replace: replace convex mirror			CA\$ 0.00
Repair Story:				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00166WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Electrical - Headlight Replace: check headlights for going dim			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	: repair 5th wheel air line leak			CA\$ 0.00
Repair Story:				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00064WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 20,533

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 903,899

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Service / PM - CVIP / DOT Inspection: CVIP inspection wheels on	1.5		CA\$ 0.00

Repair Story: Adam Kohler - 01/22/2025: Completed Inspection

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Cab - Window Replace - Windshield: Change cracked windshields	3		CA\$ 0.00

Repair Story: Adam Kohler - 01/22/2025: Removed old windows and installed new
Jeff Franklin - 01/22/2025: help remove and install new windshields



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00064WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Fuse / Relay Replace: Diag. front work lights not working	3		CA\$ 0.00
Repair Story: Adam Kohler - 01/22/2025: Found blown fuse, changed, blew right away, unplugged lights installed new fuse, plugged lights in one at a time, drivers light is causing fuse to blow, Jeff Franklin - 01/22/2025: remove old driving lights, test for power and ground, drill new holes and mount new driving lights right and left sides, had to be mounted on slight angle due to size and space available				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00005WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 20,387

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 897,585

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Cooling - Surge / Overflow Tank Replace: Change leaking surge tank	0.5		CA\$ 0.00

Repair Story: Adam Kohler - 01/03/2025: Drained coolant and removed old surge tank, installed new and refilled coolant

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Tires - Tire Replace: Rotate axle 4 tires to axle 3 and install new tires on axle 4	1.5		CA\$ 0.00

Repair Story: Adam Kohler - 01/03/2025: removed tires from axle 4 and axle 3, installed used tires on axle 3 and put new tires on axle 4 torqued wheels to spec

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2025-00005WO

Closing Date

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02648WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 20,316

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 894,372

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Drivetrain - Driveshaft Replace: service call to Meota Saskatchewan	9.5		CA\$ 0.00
Repair Story: Jeff Franklin - 12/17/2024: Take 1517 to jobsite in Saskatchewan to haul trailer loaded with 1515 that has broken driveshaft and 2 blown airbags help offload at shop				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Diagnose and Advise - Coolant Leak: coolant leaking	1		CA\$ 0.00
Repair Story: Jeff Franklin - 12/17/2024: check for coolant leaks, clean area suspected of leaking, drain coolant down a bit, remove tank hose and inspect, replace clamps, refill coolant, pressure test and found tank to be cracked				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02648WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Drivetrain - Driveshaft Replace: broken driveshaft between #3 and #4 axle	2.5		CA\$ 0.00
Repair Story: Jeff Franklin - 12/17/2024: help Cory with installing driveshaft between axles 3 and 4 Cory Thorburn - 12/17/2024: remove old broken drive shaft had to cut off old ujoint bolts, install new drive shaft torque to spec				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Suspension - Air Bag / Air Spring Replace: blown airbags #3 axle left and right	1		CA\$ 0.00
Repair Story: Cory Thorburn - 12/17/2024: replace #3 axle air bags, replace broken air line going to #4 right brake pot				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02575WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 20,155

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 891,101

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Trailer Plug / 7-Pin Receptacle Replace: replace trailer cord	1		CA\$ 0.00

Repair Story: made new trailer cord

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02575WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02557WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 20,151

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 890,888

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	HVAC - Auxiliary Heater Service (Webasto / Espar): Remove Old Wabasto, and wiring	1.5		CA\$ 0.00

Repair Story: remove old wabasto and wiring

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	HVAC - Auxiliary Heater Service (Webasto / Espar): Install new wabasto	5		CA\$ 0.00

Repair Story: install new wabasto had to drill holes in frame to mount unit, install new wiring harness, install new coolant hoses, test unit, works

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02557WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02530WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 20,103

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 889,471

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: complete service	3		CA\$ 0.00
Repair Story: replace engine oil and filter, replace both fuel filters, grease unit				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: Axle Seal	1		CA\$ 0.00
Repair Story: #2 Axle Right Axle leaking take apart Clean surfaces of Hub and Axle put bake together check Diff oil				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02530WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02456WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 19,912

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 884,334

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Drivetrain - PTO Service / Repair: PTO leaking	8.5		CA\$ 0.00

Repair Story: clean off and check for leaks, found PTO housing to be leaking, remove PTO install new PTO, check gear lashing .011, torque to spec, install new air fitting, install hydraulic pump, weld new mount bracket for pump, tie up lines, fill with fluid and test

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Electrical - Two-Way Radio Repair: bad reception on 2way radio	2.5		CA\$ 0.00

Repair Story: check antenna connections, pull cab apart, cut out old cable, install new antenna and cable, put cab back together

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Exhaust - Exhaust Clamp / Hanger Replace: right side stack loose	1		CA\$ 0.00

Repair Story: check stack bushings, remove old stack bushing assembly and replace

Parts:



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02456WO

Closing Date

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02407WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 19,865

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 883,136

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Cooling - Fan Hub Replace: fan clutch leaking	5		CA\$ 0.00

Repair Story: remove fan belt, remove, alternator, remove airline, remove fan, remove fan hub, pull apart and rebuild, remove small belt and tensioner, install fan hub, install fan, install belt, install small tensioner, bolt ended up stripped when removing, drilled out and tapped, installed helicoil, install tensioner, install air line, install alternator and test

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Diagnose and Advise - Exhaust Leak: exhaust leak	5		CA\$ 0.00

Repair Story: test for leaks, found elbow on right side split, remove elbow and inspect, seemed to be custom made, clean up split area and weld back together, reinstall elbow and check for leaks, found another leak on downpipe joint from turbo, remove clamp, clean and reclamp, test for leaks
left stack bolts hitting cab, remove stack clamp at the bottom, pry stack to proper position and install new clamp



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02407WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	: yolk nut loose behind steady bearing	2		CA\$ 0.00

Repair Story: upon inspection, found yolknut was loose behind steady bearing, remove driveshaft, remove yolk nut, clean area and tighten yolk nut, prep yolk for driveshaft and install driveshaft, torque to spec

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Tires - Tire Replace: mid service filter change and oil top up	1		CA\$ 0.00

Repair Story: remove filter and replace, top up oil, run unit and double check levels, top up fluids, grease and check lights

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Cooling - Fan Hub Replace: coolant leak	1		CA\$ 0.00

Repair Story: check for coolant leaks, found to be leaking from hose clamp at tank drain, drain coolant down enough to remove hose, cleaned area, cut off damaged end of hose, reinstalled and installed new clamp, tested and not leaking

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02407WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02343WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours: 19,708

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's: 876,728

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Fuse / Relay Replace: Diag no start	5		CA\$ 0.00

Repair Story: Hooked up computer and wouldn't connect, searched for fuse for ecm. finally found it was blown, fuel pump did wiggle tested blew fuse. after getting pump changed its was running ruff and dying. loosened turbo and would run, turbo needs to be replaced

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Fuel - Transfer / Lift Pump Replace: Change low pressure pump	3.5		CA\$ 0.00

Repair Story: remove lines, remove brackets, remove pump, take spare pump and clean up, install used pump and reconnect lines, still no start, after testing found front line to pump sucking air, remove line and install used line from seacan



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02343WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Intake - Turbocharger Replace: Replace turbo	5.5		CA\$ 0.00

Repair Story: removes wiring, remove intake pipe and exhaust pipes, remove oil and coolant lines, pull turbo, prep new turbo for install, broke a bolts trying to remove and replace studs, tried to drill out and failed, remove exhaust manifold, customize pipe that was in the way, install new manifold, as i torqued to spec, 1 bolt failed and broke, remove manifold and extract bolt, install manifold and torque to spec, install turbo and torque to spec, clean and replace all banjo washers and install all lines, install intake and exhaust piping, adjust turbo angle to fit pipes

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02257WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours:

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Exhaust - Exhaust Pipe Replace: left stack mount bolt hitting cab	1		CA\$ 0.00

Repair Story: check for adjustment bolts, stack needs to be unclamped below, straightened and reclamped, cut long bolt off so not hitting anymore until we have time to straighten stack

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02257WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02210WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 19,550

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 869,554

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Service Unit	1.5		CA\$ 0.00
Repair Story: Changed oil and oil filter, changed fuel filter, greased unit				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Cooling - Radiator Repair: Wash out rad	3		CA\$ 0.00
Repair Story: removed a/c condenser, removed charge air cooler,Pressure washed rad and charge air cooler and reinstalled everything				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Wiring Harness Repair: Diag. and fix speedo	2		CA\$ 0.00
Repair Story: unplugged sensor and checked pins they are good, removed shifter boot to check the rest of wiring, found frayed wire close to connector were transmission harness connects to body harness, installed spice tapped and zip tied.				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02210WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Drivetrain - Driveshaft Replace: Remove drive shaft at axle 2 input to send for repair (cap spinning)	5		CA\$ 0.00
Repair Story: remove drive shaft, remove stripped ujoint bolts, install new bolts and straps, install new u-joint, install driveshaft, torque to spec and mark				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	General - Pressure Wash: wash unit	1.5		CA\$ 0.00
Repair Story: pull outside, detail wash unit for job in the am				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Cooling - Coolant Pump (Water Pump) Replace: Change leaking water pump	3		CA\$ 0.00
Repair Story: remove water pump, install ew water pump torque to spec				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
7	Cab - Window Replace - Windshield: change cracked windshields			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
8	Tires - Tire Replace: replace tires	3		CA\$ 0.00
Repair Story: replace tire from #2 axle put on #4 axle move tires from #3, #4 forward torque to spec				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-02210WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
9	: #4 right wheel seal	2.75		CA\$ 0.00

Repair Story: remove hub clean parts found washer was broken ordered new nut install hub with new nut torque to spec

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01769WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Unit needed parts			CA\$ 0.00
Repair Story: Purchased from Glover				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01751WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: weld shim in 5th wheel	0.5		CA\$ 0.00
Repair Story: weld shim in 5th wheel				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: full service	2		CA\$ 0.00
Repair Story: oil change, oil filter and both fuel filters changed quick inspection and grease job, VCS set to 65mph for BC, replace fuel cap rubber left side				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Suspension - Air Bag / Air Spring Replace: #3 left air bag blown	4.5		CA\$ 0.00
Repair Story: remove blown air bag #3 left, inspect unit, found #2 and 3 right airbags to be worn, remove and replace #2 and 3 right air bags as well as #3 left				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01751WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Electrical - Two-Way Radio Repair: 2 way radio mount broken	1.5		CA\$ 0.00
Repair Story: pull headliner down, pull out cb tray, customize tray to fit 2 way and install, put headliner back together				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Software - Calibration / Parameter Set: VSS- 105kms	1		CA\$ 0.00
Repair Story: grab truck from yard to reduce speed for BC job, part way through and told to leave it until after 1 last run, return truck to lineup				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01707WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Unit needed a new speed sensor			CA\$ 0.00
Repair Story: Purchased from Glover				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01666WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 19,074

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 852,833

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Tires - Tire Replace: Change front tires	2.5		CA\$ 0.00
Repair Story: Installed ne front tires and torqued wheel to spec				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Drivetrain - Hub / Drum Service: Diag. and fix front tire waering weird	3		CA\$ 0.00
Repair Story: found front right bearing spaced worn				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Drivetrain - Speed Sensor Replace: Diag and fix speedo bouncing around	1		CA\$ 0.00
Repair Story: Tried to remove sensor broke apart, removed cuncks and install new sensor				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01666WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	: weld shim in 5th wheel	1		CA\$ 0.00
Repair Story: weld shim in 5th wheel				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	: Unit needed a tire			CA\$ 0.00
Repair Story: Purchased from Fountain Tire				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Intake - Turbocharger Replace: Install turbo actuator	2		CA\$ 0.00
Repair Story: Drianerd coolant removed actuator and calabrated and installed new, refilled coolant				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01520WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	General - Other (Specify in Detail): Unit required work			CA\$ 0.00
Repair Story: Completed at On Track				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: Unit required parts			CA\$ 0.00
Repair Story: Purchased from Kenworth.				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	: Unit needed turbo actuator			CA\$ 0.00
Repair Story: Purchased from On Track.				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01520WO

Closing Date

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01544WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 18,919

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 847,927

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Engine - Oil and Filter Service: Chnaage oil and filter	1		CA\$ 0.00
Repair Story: changed oil and filter				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: check and fix coolant leaks	0.5		CA\$ 0.00
Repair Story: found upper rad hose leaking and line to wabasto, tightened clamps pressured up leaks are gone				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Marker / Clearance Light Replace: Change fender lights	0.5		CA\$ 0.00
Repair Story: removed old installed new tested they work				

Parts:

Labour Billed:CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01544WO

Closing Date

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01356WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Connector / Pin Repair: Front flashing lights not working	1		CA\$ 0.00

Repair Story: wire pulled out of weather pack, installed new pin and reinstalled also installed inline fuse

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Steering - Power Steering Service: Power steering leak	0.5		CA\$ 0.00

Repair Story: Found leak at pump and tightened

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Connector / Pin Repair: Front lights flickering	1.5		CA\$ 0.00

Repair Story: cut out connector from factory to aftermarket lights and installed weather pack no change, pulled light and tested power and ground both good, need new light



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01356WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	: Low beam headlight for unit			CA\$ 0.00
Repair Story: Purchased from Glover				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01142WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Cooling - Fan Hub Replace: Diag. noise coming from front cover	31		CA\$ 0.00

Repair Story: AK-Evacuated A/C system and pulled air compressor, alt, fan hub, and acc. bracket, pulled front cover and dampener and lower cover found bolts had broken in ideler gear and fiber was worn to the point its gone, drain coolant, pull hood straps, remove oil pickup tube, oil pump block stiffener. clean block install front cover and gears, clean parts, install block stiffener, oil pump and pickup tube, oil pan. install fan and belt.
AK- installed new front cover, timed engine, cover and accesories, installed rad and filled with coolant, did valve set, filled oil anmd brought outside to run, checked for codes were none.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	HVAC - Heater Hose Replace: fix coolant leak	0.25		CA\$ 0.00

Repair Story: replace coolant hose at heater core

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01142WO

Closing Date

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01131WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Diagnose and Advise - General Inspection / Walkaround: diagnose engine noise	2		CA\$ 0.00

Repair Story: listened to engine, didn't sound right, shut off, dropped trailer, aired up, used another unit in yard to pull up to shop, lock out tag installed

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01131WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01060WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	General - Other (Specify in Detail): Unit required warranty work and Dyno engine breakin			CA\$ 0.00

Repair Story: Work done by Edmonton Kenworth

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01060WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01000WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Find A/C leak	2		CA\$ 0.00

Repair Story: Added ac to system manually and let sit for 30 mins, sprayed everything down found no leaks, filled system

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Drivetrain - Transmission Replace: Install Transmission, drive shaft	18		CA\$ 0.00

Repair Story: stab transmission, torque bell housing bolts to spec, install clutch bolts and torque to spec
AK- hooked up the Clutch linkage, installed the transmission suport, installed the shift and trans cooler, remove airlines and install hydraulic pump, hook up airlines and cooler lines , prep pipes for install, chase wiring for shift tower button, loosen bell housing and remove p-clamp, retorque bell housing to spec, install new bolts on hydraulic pump hanger



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01000WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Engine - Engine Replace: Install Engine	17		CA\$ 0.00

Repair Story: Hooked up a/c filled up coolant system, tried to fill a/c but machine said there was a leak, ran engine for an hour checked for leaks, removed flywheel to check rear main for leaks was none, reinstalled fly wheel and torqued to spec.

AK- couldn't get front off road lights to work, checked the switch it was no good, change it still wouldn't work, pulled dash apart and found relay got good power but weak ground installed new ground and tested only one worked, check plug at light both power and ground present,

AK-Truckkept stalling, hooked scanner to it had no codes, checked grounds on was broken off installed new eyelet and reinstall on engine ground stud took for long test drive works well now

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	: Unit required screws			CA\$ 0.00

Repair Story: Purchased from Glover

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	: Unit required Gaskets			CA\$ 0.00

Repair Story: Purchased from Kenworth

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Body - Hood Latch / Hinge Repair: Adjust hood so it stops hitting cab	1.25		CA\$ 0.00

Repair Story: Loosed bolts moved hood forward and retightened, loosed rear mounts and moved forward and retightened, hood fits better now

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
7	Diagnose and Advise - Gauge / Display Issue: Diff lock light staying on	0.25		CA\$ 0.00

Repair Story: checked lights all were off, switched them on and off, work as intended



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01000WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
8	HVAC - Auxiliary Heater Service (Webasto / Espar): Bunk webasto fan staying on	1.25		CA\$ 0.00
Repair Story: Checked it is staying on, checked for code through timer was none, talked with Dave he helped me down load the app, got code 9Bh. did seach on the net found it was a controller conection issue, zip tied conectors together and is now working as intended				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
9	Diagnose and Advise - General Inspection / Walkaround: Re-inspection	1		CA\$ 0.00
Repair Story: Re-inspected after brake in				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
10	: Unit required pressure sensor			CA\$ 0.00
Repair Story: Purchased from Glover				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 1,744.63

Work Order Total after GST: CA\$ 1,831.86



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-01000WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00806WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Cooling - Radiator Cap Replace: check for coolant leaks	1.5		CA\$ 0.00
Repair Story: pull truck in, pressure test coolant system, found pressure release cap to be faulty				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Engine - Cylinder Head Replace: Remove Head	37.75		CA\$ 0.00
Repair Story: AK- pulled vavle cover, and injectors, drained coolant and drained ac, pulled intake, fuel rails and lines, pulled wire harness for injectors, pulled rockers, removed fan, fan hub, removed dampner, removed front cover, pulled cam sensor, pulled gears and pulled cam, pulled head and inspected, remove all lines and wiring harness, pull block, tidy truck and parts up, cap lines, pull truck outside, clean up floor				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	: Unit required a cap			CA\$ 0.00
Repair Story: Purchased from Kenworth				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00806WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	: Unit required water filter			CA\$ 0.00
Repair Story: Purchased from Diamond				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Drivetrain - Transmission Replace: 16 pull transmission			CA\$ 0.00
Repair Story: remove driveshaft and steady bearing, remove cross supports, remove hydraulic pump, remove all lines and wires, remove clutch bolts, remove exhaust pipes, pull shift tower and transmission cooler, pull bell housing bolts and drop transmission down, drain oil from engine				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	: Unit required Gaskets, seals, Cyl. Head Assembly			CA\$ 0.00
Repair Story: Purchased from Glover				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
7	Engine - Engine Replace: Assemble engine	41.5		CA\$ 0.00
Repair Story: same				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
8	: Unit required flywheel			CA\$ 0.00
Repair Story: Purchased from NAPA				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
9	Aftertreatment - EGR Cooler Bypass Repair: EGR cooler bypass / actuator repair.	1		CA\$ 0.00
Repair Story: welded cap for egr cooler delete on exhaust manifold				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00806WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
10	Drivetrain - Transmission Replace: Install input kit	2.5		CA\$ 0.00
Repair Story: Removed worn input shaft, and cross shafts				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
11	Engine - Engine Mount Replace: Install front and rear motor mounts	1.5		CA\$ 0.00
Repair Story: Removed old mounts				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
12	Overhead - Other (Specify in Detail): bring unit in to melt off	2.5		CA\$ 0.00
Repair Story: air up unit outside and use skid steer to push into shop to melt off				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
13	: Unit required inframe kit			CA\$ 0.00
Repair Story: Purchased from On Track				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
14	: Unit required Water Pump	1		CA\$ 0.00
Repair Story: Purchased from Glover				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
15	: Unit required motor mount rear and flange bolts	1.5		CA\$ 0.00
Repair Story: Purchased from Diamond				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00806WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
16	: Unit required clutch kit			CA\$ 0.00
Repair Story: Purchased from Diamond				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
17	Engine - Engine Replace: install rebuilt engine	25.5		CA\$ 0.00
Repair Story: prep for install, lift and set into frame, start assembling, Installed in truck and bolted front and rear mounts, install rad and continue to reassemble				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
18	: Unit required plug			CA\$ 0.00
Repair Story: Purchased from schnell and Barrie				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
19	: Unit required hose parts			CA\$ 0.00
Repair Story: Purchased from Schnell and Barrie				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
20	: Unit required Coolant parts			CA\$ 0.00
Repair Story: Purchased from KJs Repair				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 19,216.87

Work Order Total after GST: CA\$ 20,177.71



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00806WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00794WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	General - Other (Specify in Detail): Unit required road side wheel retorque			CA\$ 0.00

Repair Story: Done by Stahl

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 55.94

Work Order Total after GST: CA\$ 58.74



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00794WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00780WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Air System - Air Tank Replace: fix air fitting on air tank.	0.5		CA\$ 0.00
Repair Story: take the fitting off and put on a new one.				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00780WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00776WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 18,548

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Air System - Air Line Repair: Find and fix air leaks	2.5		CA\$ 0.00

Repair Story: Found 3 air leaks. one at the pto, one 1/4 inch line on left rear air tank, and air dryer is leaking throu exhaust, fix them and air was cooming out the dryer while filling, installed new dryer cartridge air leaks are good now

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: Axle 3 left wheel seal leaking	2.5		CA\$ 0.00

Repair Story: Removed wheels, drum, brakes, and hub, cleaned everything and installed a new wheel seal,brakes and drum, reinstalled wheels , torqued wheels to spec, set brake, and topped up diff

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00776WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00633WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 18,443

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 824,768

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Axle gasket on axle 4 left leaking	0.75		CA\$ 0.00

Repair Story: unbolted and removed axle, cleaned surfaces and installed new gasket, reinstalled the axle and torqued

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Diagnose and Advise - Rough Idle: Check intermittent idle issue at 900 rpm	0		CA\$ 0.00

Repair Story: Found no issue

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00633WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00631WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours: 18,443

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 824,768

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Cooling - Coolant Service / Flush: Diag and fix coolant leaks	3		CA\$ 0.00

Repair Story: Pressure tested found leaks, drained system, replaced clamps, refilled system, repressure tested found more leaks fixed them and, retested seems good topped up system

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00631WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00574WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Body - Hood Latch / Hinge Repair: Fix hood alignment	2.5		CA\$ 0.00

Repair Story: Found some flat bar drilled holes, installed rivnuts and bolted in place, alined mount and bolted in place

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Intake - Charge Air Cooler Repair: re-adjust charge air pipe	0.5		CA\$ 0.00

Repair Story: same

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Marker / Clearance Light Replace: diagnose and repair lights out	2.5		CA\$ 0.00

Repair Story: check for power and ground and replace lights



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00574WO

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	HVAC - Auxiliary Heater Service (Webasto / Espar): diagnose webasto fan staying on	1		CA\$ 0.00
Repair Story: reset head unit and tested all good				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	: Required cap.			CA\$ 0.00
Repair Story: Purchased from Kenworth.				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 72.10

Work Order Total after GST: CA\$ 75.71



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00207WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	General - Other (Specify in Detail): Purchased per Matty as this was a driver error.			CA\$ 0.00

Repair Story: Same.

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 479.98

Work Order Total after GST: CA\$ 503.98



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00207WO

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00106WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours:

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's: 812,730

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Diagnose and Advise - No Start: boost	0.5		CA\$ 0.00
Repair Story: boosted truck				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Diagnose and Advise - Engine Fault Code: Water in Fuel light on	3.25		CA\$ 0.00
Repair Story: checked wires to see if they were corroded, hooked up computer and checked voltages changed when unplugged, shorted across wire and the responded correctly, need sensor, changed sensor, still no good, couldn't get the connector to lock in, load tested the wires on the pig tail there were good, checked for 5 volt ref. without and with pig tail both were good, Changed broken connector, reinstalled. completed the cummins verification and cleared inactive codes				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	: Unit required WIF sensor and wiper blades.	0.25		CA\$ 0.00
Repair Story: Ordered from Kenworth. Unscrew the old ones off and screw the new ones on.				

Parts:



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00106WO

Closing Date

Labour Billed: CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 119.74

Work Order Total after GST: CA\$ 125.73



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00067WO

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours:

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	HVAC - Defrost Repair: check heat deflector / air selector switch, cycles through all positions floor to defrost had good air flow through floor and defrost	1		CA\$ 0.00
Repair Story: same				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Engine - Valve Cover Gasket Replace: pull valve cover clean up and reinstall	1		CA\$ 0.00
Repair Story: same				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

2024-00067WO

Closing Date

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-20231310

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's: 808,058

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	HVAC - Heater Hose Replace: Fix coolant leak at Wabasto water pump	1		CA\$ 0.00

Repair Story: found leak at clamps, installed new clamps and pressure tested to 16 psi not leaks

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Tires - Tire Repair (Plug / Patch): Find and fix axle 4 left outter tire leaking	2		CA\$ 0.00

Repair Story: attempted to find leak with tire on, and couldnt.

Had to take the tire off and fill it. found the hole on the tread.

let the air out of tire tire and break the bead. pull half the tire off rim .

there was a self tapper in the tire, no where to really get a grip on it. it eventually came out.

sand out the rough inside of the tire. make hole bigger with special tool. put glue on the inside and pull the plug trough. cut whatever is left. and press down on the inside to make sure the patch covers fully



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-20231310

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Electrical - Tail Light Replace: Left rear tail light staying on	1		CA\$ 0.00
Repair Story: light was internally shorted, installed new light and pig tail as they were different				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	Electrical - Marker / Clearance Light Replace: left step light not working	0.25		CA\$ 0.00
Repair Story: checked power and ground, installed new bulb				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	General - Custom Fabrication / Build: Mat bunk bracket bent	3		CA\$ 0.00
Repair Story: remove bent bracket, fab and weld on new bracket				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Diagnose and Advise - Engine Fault Code: Check engine light on	16.5		CA\$ 0.00
Repair Story: Hooked up computer and scanned with insite, got code 0559, fallowed trouble shooting tree, changed primary filter, and cleaned the fuel tank breathers, took for a test drive no change, checked the fuel injector leakage, was lower then the test wanted and siad to change the fuel metering valve, changed it took for another test drive still no change, did a fuel injector preforance test, injector 1 failed at high (30458 psi), removed valve cover and injector #1, Installed new injector and torqued everything to spec. test drive, changed the high pressure pump head. TOOK FOR TEST DRIVE SEEMS GOOD, TIED UP ALL LOOSE WIRES				

Parts:

Labour Billed: CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 1,096.73

Work Order Total after GST: CA\$ 1,151.57



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-20231310

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-20231167

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Diagnose and Advise - Loss of Power: Diag loss of power	1.5		CA\$ 0.00

Repair Story: Checked codes and got 2 inactive codes coolant low (RED) and fuel pressure below threshold(amber) deleted and did a cold fuel pressure leakdown test was good, and a hot engine leakdown test was also good

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Diagnose and Advise - Air Leak (Truck Air System): Axle 4 left out tire going low.	0.5		CA\$ 0.00

Repair Story: Sprayed tire and didn't find a leak, filled tire and looked for a leak still found nothing

Parts:

Labour Billed: CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-20231167

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-20231058

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: replace leaking wheel seal , ale 3 left	3.5		CA\$ 0.00

Repair Story: release brakes, loosen brake pads take off tires, drum and hub. clean and replace wheel seal. put everything back together then reset brakes. clean up.

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Brakes - Service Brake Adjustment: 3rd axel left brake smoking	2.5		CA\$ 0.00

Repair Story: test drive truck near mirror, adjust brake drive and back to shop.

Parts:

Labour Billed: CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-20231058

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023716

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: REAR RIGHT AXEL GASKET	1		CA\$ 0.00
Repair Story: REPLACE AXEL GASKET TOP DIFF OIL UP				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	: Service	1.5		CA\$ 0.00
Repair Story: Changed oil and filter, changed fuel filters, greased unit, and completed inspection				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Cooling - Fan Hub Replace: Fix fan hub	4.5		CA\$ 0.00
Repair Story: Removed fan hub and rebuilt, and reinstalled				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023716

Closing Date

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023476

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Attachment - 5th Wheel Slide Repair: SLIDE 5TH WHEEL	0.5		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Diagnose and Advise - No Start: diagnose intermident no start order startyer			CA\$ 0.00
Repair Story:				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 525.00

Work Order Total after GST: CA\$ 551.25



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023476

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023435

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Tires - Tire Repair (Plug / Patch): LOW TIRE	0.5		CA\$ 0.00
Repair Story: PUT AIR IN FRONT LEFT OUTSIDE DRIVE COULD NOT FIND A LEAK OR ANYTHING IN TIRE				

Parts:

Labour Billed: CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023435

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023410

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Overhead - Other (Specify in Detail): license	0.5		CA\$ 0.00
Repair Story: come back to shop and get paper work for jessie				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023410

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023379

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's: 772,622

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Service	1.5		CA\$ 0.00
Repair Story: Change oil, oil filter, fuel filter, greased unit, completed inspection				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Electrical - Marker / Clearance Light Replace: Right putter light on headache rack out	1		CA\$ 0.00
Repair Story: Tested power ground and installed new light				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Diagnose and Advise - Engine Fault Code: Scan for engine light	1		CA\$ 0.00
Repair Story: Scanned got inactive code for vgt				

Parts:

Labour Billed:CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023379

Closing Date

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023303

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours:

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Electrical - Wiring Harness Repair: Left rear turn signals not working	2.5		CA\$ 0.00

Repair Story: Traced wires to junction box, no power there, traced wires to another junction box found lots of corrosion cut wire and hard wired them in...

Parts:

Labour Billed: CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023303

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023268

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours:

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	Diagnose and Advise - No Start: Boost	1		CA\$ 0.00

Repair Story:

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023268

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023238

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515
Manufacturer: Kenworth
Year: 2014
Hours:

Serial Number: 1XKDP4TX8ER969355
Model: T800
KM's:

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Service	1.5		CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Tires - Tire Replace: Tires	4.5		CA\$ 0.00
Repair Story: Dismount and remount 6 tires				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023238

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023223

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Manufacturer: Kenworth

Year: 2014

Hours:

Serial Number: 1XKDP4TX8ER969355

Model: T800

KM's: 763,666

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: Service	1.5		CA\$ 0.00
Repair Story: Oil, filters, grease				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Tires - Tire Replace: Drive tire replacement	6		CA\$ 0.00
Repair Story: Changed all drive tires, cleaned bead sealing surface, torqued wheels to spec				

Parts:

Labour Billed:CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 0.00

Work Order Total after GST: CA\$ 0.00



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023223

Closing Date



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023068

Closing Date

Account:

Road to Rail Construction Group Inc

RR1 Site 5 Box 9

Camrose,AB Canada T4V 2M9

Customer PO:

Unit: 1515

Serial Number:

Manufacturer:

Model:

Year:

Hours:

KM's: 736,733

Repair Line Items:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
1	: OIL CHANGE, LEVEL 1, FUEL FILTERS.			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
2	Intake - Air Filter Replace - Primary: REPLACE AIR FILTERS			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
3	Drivetrain - Clutch Adjustment: ADJUST CLUTCH			CA\$ 0.00
Repair Story:				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023068

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
4	General - Other (Specify in Detail): REPLACE FIRE EXT, UPDATE SAFTY			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
5	Cab - Door Latch / Handle Replace: REPLACE DRIVER DOOR OUTER LATCH			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
6	Diagnose and Advise - Air Leak (Truck Air System): REPAIR INTERAXLE LOCK AIR LEAK			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
7	Diagnose and Advise - Coolant Leak: REPAIR COOLANT LEAK ON RIGHT SIDE OF ENGINE			CA\$ 0.00
Repair Story:				

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
8	Exhaust - Exhaust Pipe Replace: REPLACE EXHAUST BELLOWS LEAKING DOWN FROM TURBO			CA\$ 0.00
Repair Story:				



Road to Rail Construction Group Inc.

RR1 Site 5 Box 9

Camrose, AB Canada T4V 2M9

WO-2023068

Closing Date

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
9	Diagnose and Advise - Oil Leak: REPAIR OIL LEAK ON AXLE 3 RIGHT WHEEL			CA\$ 0.00

Repair Story:

Line Number:	Repair Description:	Tech Hours:	Rate:	Labour Charged:
10	: REPAIR A/C			CA\$ 0.00

Repair Story:

Parts:

Labour Billed: CA\$ 0.00

Parts Total: \$

Consumables: CA\$ 0.00

Work Order Total before GST : CA\$ 1,446.63

Work Order Total after GST: CA\$ 1,518.96